

## VMware Deliverable Release Notes

This document does not apply to HPE Superdome servers. For information on HPE Superdome, see the following links:

[HPE Integrity Superdome X](#)  
[HPE Superdome Flex](#)

Information on HPE Synergy supported VMware ESXi OS releases, HPE ESXi Custom Images and HPE Synergy Custom SPPs is available at:

[OS Support Tool for HPE Synergy](#)

Information on HPE Synergy Software Releases is available at:

[HPE Synergy Software Releases - Overview](#)

---

## Gen10 SPP 2025.03.00.00 Release Notes for VMware ESXi 9.0

[BIOS - System ROM](#)

[Driver - Lights-Out Management](#)

[Driver - Network](#)

[Firmware - Network](#)

[Firmware - Storage Controller](#)

[Firmware - Storage Fibre Channel](#)

[Software - Management](#)

[Software - Storage Controller](#)

[Software - Storage Fibre Channel](#)

[Software - System Management](#)

### Driver - Lights-Out Management

[Top](#)

HPE iLO Native Driver for ESXi 8.0 and ESXi 9.0

Version: 10.9.0 **(Recommended)**

Filename: ilo-driver\_800.10.9.0.17-1OEM.800.1.0.20613240\_24608328.zip

### Fixes

The product addressed a probabilistic PSOD when repeatedly doing the OS reboot.

### Enhancements

- Add support for the new ESXi 9.0
- Remove support for the ESXi 7.0.

---

### Driver - Network

[Top](#)

HPE Broadcom NetXtreme-E Drivers for VMware vSphere 9.0

Version: 2025.03.00 **(Recommended)**

Filename: cp063771.compsig; cp063771.zip

### Important Note!

- This component is intended to be used by HPE applications. It is a zip file that contains the same driver deliverable available from the vmware.com and the HPE vibspot.hpe.com webpages, plus an HPE specific CP0xxxxx.xml file.
- HPE recommends the *HPE Broadcom NetXtreme-E Firmware Version, 232.1.132008* or later, for use with this driver.

### Enhancements

Initial release.

### Supported Devices and Features

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 535FLR-T Adapter
- HPE Ethernet 10Gb 2-port 535T Adapter
- HPE Ethernet 10Gb 2-port 537SFP+ Adapter
- HPE Ethernet 10Gb 2-port 537SFP+ FLR Adapter
- HPE Ethernet 10/25Gb 2-port 631FLR-SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 631SFP28 Adapter
- HPE Ethernet 10Gb 2-port SFP+ BCM57412 OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ BCM57412 Adapter
- HPE Ethernet 10Gb 2-port BaseT BCM57416 OCP3 Adapter
- HPE Ethernet 10Gb 2-port BaseT BCM57416 Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 OCP3 Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 Adapter
- Broadcom BCM57504 Ethernet 10/25Gb 4-port SFP28 Adapter for HPE
- Broadcom BCM57504 Ethernet 10/25Gb 4-port SFP28 OCP3 Adapter for HPE
- Broadcom BCM57608 Ethernet 100Gb 2-port QSFP112 Adapter for HPE
- Broadcom BCM57608 Ethernet 100Gb 2-port QSFP112 OCP3 Adapter for HPE

---

HPE Intel i40en Driver for VMware vSphere 9.0  
Version: 2025.03.00 **(Recommended)**  
Filename: cp065386.compsig; cp065386.zip

**Important Note!**

This component is intended to be used by HPE applications. It is a zip file that contains the same driver deliverable available from the vmware.com and the HPE vibsddepot.hpe.com webpages, plus an HPE specific CP0xxxxx.xml file.

HPE recommends the firmware provided in *HPE Intel Online Firmware Upgrade Utility for VMware*, version 3.25.0 or later, for use with this driver.

**Enhancements**

Initial version for VMware 9.0.

**Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 1Gb 2-port 368FLR-MMT Adapter
- HPE Ethernet 1Gb 2-port 368i Adapter
- HPE Ethernet 1Gb 4-port 369i Adapter
- HPE Ethernet 10Gb 2-port 562FLR-SFP+ Adapter
- HPE Ethernet 10Gb 2-port 562SFP+ Adapter
- HPE Ethernet 10Gb 2-port 563i Adapter
- HPE Ethernet 10Gb 2-port 568FLR-MMSFP+ Adapter
- HPE Ethernet 10Gb 2-port 568FLR-MMT Adapter
- HPE Ethernet 10Gb 2-port 568i Adapter
- HPE Ethernet 10Gb 2-port SFP+ OCP3 X710-DA2 Adapter
- HPE Ethernet 10Gb 2-port SFP+ X710-DA2 Adapter

---

HPE Intel igbn Driver for VMware vSphere 9.0  
Version: 2025.03.00 **(Recommended)**  
Filename: cp065455.compsig; cp065455.zip

**Important Note!**

This component is intended to be used by HPE applications. It is a zip file that contains the same driver deliverable available from the vmware.com and the HPE vibsddepot.hpe.com webpages, plus an HPE specific CP0xxxxx.xml file.

HPE recommends the firmware provided in *HPE Intel Online Firmware Upgrade Utility for VMware*, version 3.24.0 or later, for use with this driver.

**Enhancements**

Initial version.

**Supported Devices and Features**

These drivers support the following network adapters:

- HPE Ethernet 1Gb 2-port 361T Adapter
- HPE Ethernet 1Gb 2-port 361i Adapter
- HPE Ethernet 1Gb 2-port 363i Adapter
- HPE Ethernet 1Gb 4-port 366FLR Adapter
- HPE Ethernet 1Gb 4-port 366T Adapter
- HPE Ethernet 1Gb 4-port 366i Adapter
- HPE Ethernet 1Gb 4-port 366i Communication Board
- Intel I350-T4 Ethernet 1Gb 4-port BASE-T Adapter for HPE
- Intel I350-T4 Ethernet 1Gb 4-port BASE-T OCP3 Adapter for HPE
- Intel(R) I350 Gigabit Network Connection

---

HPE Intel ixgben Driver for VMware vSphere 9.0  
Version: 2025.03.00 **(Recommended)**  
Filename: cp065456.compsig; cp065456.zip

**Important Note!**

This component is intended to be used by HPE applications. It is a zip file that contains the same driver deliverable available from the vmware.com and the HPE vibsdepot.hpe.com webpages, plus an HPE specific CP0xxxxx.xml file.

HPE recommends the firmware provided in *HPE Intel Online Firmware Upgrade Utility for VMware*, version 3.23.0 or later, for use with this driver.

### **Enhancements**

Initial version for VMware 9.0.

### **Supported Devices and Features**

These drivers support the following network adapters:

- HPE Ethernet 10Gb 2-port 560SFP+ Adapter
- HPE Ethernet 10Gb 2-port 560FLR-SFP+ Adapter
- HPE Ethernet 10Gb 2-port 561T Adapter
- HPE Ethernet 10Gb 2-port 561FLR-T Adapter
- HPE Ethernet 10Gb 2-port 562T Adapter
- HPE Ethernet 10Gb 2-port 562FLR-T Adapter

---

HPE QLogic FastLinQ 10/25/50 GbE Multifunction Driver for VMware vSphere 9.0

Version: 2025.03.00 (**Recommended**)

Filename: cp064705.compsig; cp064705.zip

### **Important Note!**

This component is intended to be used by HPE applications. It is a zip file that contains the same driver deliverable available from the vmware.com and the HPE vibsdepot.hpe.com webpages, plus an HPE specific CP0xxxxx.xml file.

HPE recommends the firmware provided as below for use with these drivers,

- HPE QLogic FastLinQ Firmware Package for Arrowhead adapters, version 8.65.23 or later.
- HPE QLogic FastLinQ Online Firmware Upgrade Utility for VMware, version 4.20.0 or later.

### **Enhancements**

This product now supports VMware vSphere ESXi 9.0.

Known issue: When any operations that cause the driver reset may result subsequently in high EnsNetWorlds CPU utilization. Target to have full solution in next driver release

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 521T Adapter
- HPE Ethernet 10Gb 2-port 524SFP+ Adapter
- HPE Ethernet 10/25Gb 2-port 621SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 622FLR-SFP28 Converged Network Adapter
- HPE StoreFabric CN1200R-T Converged Network Adapter
- HPE StoreFabric CN1300R Converged Network Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 QL41232HVCU OCP3 Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 QL41232HLCU Adapter
- HPE Ethernet 10Gb 4-port SFP+ QL41134HLCU Adapter
- HPE Ethernet 10Gb 2-port BaseT QL41132HLRJ Adapter
- HPE Ethernet 10Gb 2-port BaseT QL41132HQRJ OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ QL41132HVCU OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ QL41132HLCU Adapter

---

HPE QLogic NX2 10/20 GbE Multifunction Driver for VMware vSphere 9.0

Version: 2025.03.00 (**Recommended**)

Filename: cp064706.compsig; cp064706.zip

### **Important Note!**

This component is intended to be used by HPE applications. It is a zip file that contains the same driver deliverable available from the vmware.com and the HPE vibsdepot.hpe.com webpages, plus an HPE specific CP0xxxxx.xml file.

HPE recommends the firmware provided in *HPE QLogic NX2 Online Firmware Upgrade Utility for VMware*, version 1.37.0 or later, for

use with this driver.

## **Enhancements**

This product now supports VMware vSphere ESXi 9.

## **Supported Devices and Features**

These drivers support the following network adapters:

- HPE Ethernet 10Gb 2-port 530T Adapter
- HPE Ethernet 10Gb 2-port 530SFP+ Adapter
- HPE FlexFabric 10Gb 2-port 533FLR-T Adapter
- HPE FlexFabric 10Gb 2-port 534FLR-SFP+ Adapter
- HPE FlexFabric 10Gb 4-port 536FLR-T Adapter

---

Intel icen Driver for VMware vSphere 9.0  
Version: 2025.03.00 **(Recommended)**  
Filename: cp065336.compsig; cp065336.zip

## **Important Note!**

- This component is intended to be used by HPE applications. It is a zip file that contains the same driver deliverable available from the vmware.com and the HPE vibspot.hpe.com webpages, plus an HPE specific CP0xxxxx.xml file.
- HPE recommends the firmware provided in *Intel Firmware Package For E810 Ethernet Adapter*, version 4.60 or later, for use with these drivers.

## **Enhancements**

Initial version for VMware 9.0.

## **Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-CQDA2 Ethernet 100Gb 2-port QSFP28 Adapter for HPE
- Intel E810-CQDA2 Ethernet 100Gb 2-port QSFP28 OCP3 Adapter for HPE
- Intel E810-XXVDA4 Ethernet 10/25Gb 4-port SFP28 Adapter for HPE
- Intel E810-XXVDA2 Ethernet 10/25Gb 2-port SFP28 Adapter for HPE
- Intel E810-XXVDA2 Ethernet 10/25Gb 2-port SFP28 OCP3 Adapter for HPE
- Intel E810-2CQDA2 Ethernet 100Gb 2-port QSFP28 Adapter for HPE
- Intel E810-XXVDA4 Ethernet 10/25Gb 4-port SFP28 OCP3 Adapter for HPE

---

## **Firmware - Network**

Broadcom Firmware Package for BCM5741x adapters  
Version: 232.1.132.8 **(Recommended)**  
Filename: bcm232.1.132.8.pup.fwpkg; bcm232.1.132.8.pup.json

[Top](#)

## **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Broadcom NetXtreme-E Driver for Microsoft Windows Server, version 232.0.155.7 or later
- HPE Broadcom NetXtreme-E Drivers for Linux, version 1.10.3-232.0.155.5 or later
- HPE Broadcom NetXtreme-E Drivers for VMware, version 2025.03.00 or later

## **Fixes**

- This product fixes the issue where the OCP module experiences link width degradation in the system.
- This product fixes the issue where RDMA connections are not getting connected.
- This product fixes the issue where RoCE and TX/RX path core dump decoding failed.
- This product fixes the issue where Port 1 was not receiving broadcast packets with ESXi.
- This product fixes the issue where the OCP module experiences link width degradation in the system.
- This product fixes the issue where PXE boot does not work with VLAN configurations.

## **Enhancements**

- This product removes the Ethernet/LLDPTransmit/ManagementVlanId property to streamline configuration.
- This product enhances the coredump feature in the BNXT driver for improved diagnostics.
- This product enhances to update the driver to suppress the HII MBA menu for a cleaner interface.

**Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port SFP+ BCM57412 Adapter
- HPE Ethernet 10Gb 2-port SFP+ BCM57412 OCP3 Adapter
- HPE Ethernet 10Gb 2-port BaseT BCM57416 Adapter
- HPE Ethernet 10Gb 2-port BaseT BCM57416 OCP3 Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 OCP3 Adapter

---

Broadcom Firmware Package for BCM5750x adapters  
 Version: 232.1.132.8 **(Recommended)**  
 Filename: bcm232.1.132.8\_Thor.pup.fwpkg; bcm232.1.132.8\_Thor.pup.json

**Important Note!**

For Firmware installation, there is no OS and drivers dependency.  
 For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Broadcom NetXtreme-E Driver for Microsoft Windows Server, version 232.0.155.7 or later
- HPE Broadcom NetXtreme-E Drivers for Linux, version 1.10.3-232.0.155.5 or later
- HPE Broadcom NetXtreme-E Drivers for VMware, version 2025.03.00 or later

**Fixes**

- This product fixes the issue where the firmware fails to send a reset notification to the driver during error recovery.
- This product fixes the issue where the RDE bejString special character escape sequences were incorrectly encoded.
- This product fixes the issue where the PLDM port link speed sensor reading and event values were reported as negative.
- This product fixes the issue where the XDP/LPBK L2 context entry caused resource leaks.
- This product fixes the issue where XDP flows were not properly freed by ensuring they are released only when the MAC address is non-zero.

**Enhancements**

- This product removes the Ethernet/LLDPTransmit/ManagementVlanId property to simplify network configuration.
- This product enhances system stability by adjusting MSI-X vector counts to prevent resource exhaustion.
- This product enhances SPDM functionality by setting the MsgTag in the MCTP transport header.
- This product enhances the coredump feature in the BNXT driver for better diagnostic capabilities.
- This product enhances network performance by adding the RX rate profile and improving DPDK functionality.

**Supported Devices and Features**

This product supports the following network adapters:

- Broadcom BCM57504 Ethernet 10/25Gb 4-port SFP28 Adapter for HPE
- Broadcom BCM57504 Ethernet 10/25Gb 4-port SFP28 OCP3 Adapter for HPE

---

Broadcom NX1 Online Firmware Upgrade Utility for VMware  
 Version: 1.41.0 **(Recommended)**  
 Filename: CP064518.compsig; CP064518.zip

**Important Note!**

This software package contains combo image v20.32.41 with the following firmware versions:

NIC	Boot Code Version	PXE Version	NCSI Version	UEFI Version
BCM 5719 1GbE 4p BASE-T Adptr	1.60	21.6.4	1.60	21.6.85
BCM 5719 1GbE 4p BASE-T OCP3 Adptr	1.60	21.6.4	1.60	21.6.85
BCM 5719 1GbE 4p BASE-T LOM Adptr	1.60	21.6.4	1.60	21.6.85
BCM 5720 1GbE 2p BASE-T LOM Adptr	1.43	21.6.4	N/A	21.6.85

## **Prerequisites**

This product requires the appropriate driver for your device and operating system to be installed before the firmware is updated.

## **Fixes**

This product fixes where MBA configuration reset to defaults after updating firmware.

## **Enhancements**

This product enhances libfwupg to improve NVRAM configuration updates.

## **Supported Devices and Features**

This product supports the following network adapters:

- Broadcom BCM5720 Ethernet 1Gb 2-port BASE-T LOM Adapter for HPE
- Broadcom BCM5719 Ethernet 1Gb 4-port Base-T Adapter for HPE
- Broadcom BCM5719 Ethernet 1Gb 4-port Base-T OCP3 Adapter for HPE
- Broadcom BCM5719 Ethernet 1Gb 4-port Base-T LOM Adapter for HPE

---

HPE Broadcom NetXtreme-E Firmware Package for BCM5741x adapters

Version: 232.1.132008 (**Recommended**)

Filename: bcm232.1.132008.Optimized.pup.fwpkg

## **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Broadcom NetXtreme-E Driver for Microsoft Windows Server, version 232.0.155.7 or later
- HPE Broadcom NetXtreme-E Drivers for Linux, version 1.10.3-232.0.155.5 or later
- HPE Broadcom NetXtreme-E Drivers for VMware, version 2025.03.00 or later

## **Fixes**

- This product fixes the issue where RDMA connections are not getting connected.
- This product fixes the issue where RoCE and TX/RX path core dump decoding failed.
- This product fixes the issue where Port 1 was not receiving broadcast packets with ESXi.
- This product fixes the issue where the OCP module experiences link width degradation in the system.
- This product fixes the issue where PXE boot does not work with VLAN configurations.

## **Enhancements**

- This product removes the Ethernet/LLDPTransmit/ManagementVlanId property to streamline configuration.
- This product enhances the coredump feature in the BNXT driver for improved diagnostics.
- This product enhances to update the driver to suppress the HII MBA menu for a cleaner interface.

## **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 537SFP+ Adapter
- HPE Ethernet 10Gb 2-port 537SFP+ FLR Adapter
- HPE Ethernet 10Gb 2-port 535T Adapter
- HPE Ethernet 10Gb 2-port 535FLR-T Adapter
- HPE Ethernet 10/25Gb 2-port 631SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 631FLR-SFP28 Adapter

---

HPE Broadcom NetXtreme-E Online Firmware Upgrade Utility for VMware

Version: 5.25.0 (**Recommended**)

Filename: CP064757.compsig; CP064757.zip

## **Important Note!**

HPE recommends *HPE Broadcom NetXtreme-E Drivers for VMware*, versions 2025.03.00 or later, for use with this firmware.

This software package contains NVM Image version 232.1.132008 with the following firmware versions:

NIC	Bootcode Version	NCSI Version	MBA Version	UEFI Version	RoCE Version
HPE Ethernet 10Gb 2-port 535FLR-T Adapter	232.0.155.2	232.0.155.2	232.0.155.4	232.0.155.4	232.0.155.2
HPE Ethernet 10Gb 2-port 535T Adapter					
HPE Ethernet 10/25Gb 2-port 631FLR-SFP28 Adapter					
HPE Ethernet 10/25Gb 2-port 631SFP28 Adapter					
HPE Ethernet 10Gb 2-port 537SFP+ Adapter					
HPE Ethernet 10Gb 2-port 537SFP+ FLR Adapter					

### **Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

### **Fixes**

- This product fixes the issue where RDMA connections are not getting connected.
- This product fixes the issue where RoCE and TX/RX path core dump decoding failed.
- This product fixes the issue where Port 1 was not receiving broadcast packets with ESXi.
- This product fixes the issue where the OCP module experiences link width degradation in the system.
- This product fixes the issue where PXE boot does not work with VLAN configurations.

### **Enhancements**

- This product removes the Ethernet/LLDPTransmit/ManagementVlanId property to streamline configuration.
- This product enhances the coredump feature in the BNXT driver for improved diagnostics.
- This product enhances to update the driver to suppress the HII MBA menu for a cleaner interface.

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 537SFP+ Adapter
- HPE Ethernet 10Gb 2-port 537SFP+ FLR Adapter
- HPE Ethernet 10Gb 2-port 535T Adapter
- HPE Ethernet 10Gb 2-port 535FLR-T Adapter
- HPE Ethernet 10/25Gb 2-port 631SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 631FLR-SFP28 Adapter

---

HPE Broadcom NetXtreme-E Online Firmware Upgrade Utility for VMware

Version: 226.1.107000 (B) **(Recommended)**

Filename: CP065662.compsig; CP065662.zip

### **Important Note!**

HPE recommends *HPE Broadcom NetXtreme-E Drivers for VMware*, versions 2023.09.00 or later, for use with this firmware.

This software package contains NVM Image version 226.1.107000 with the following firmware versions:

NIC	Bootcode Version	NCSI Version	MBA Version	UEFI Version	RoCE Version
HPE Ethernet 10Gb 2-port 535FLR-T Adapter	226.0.145.0	226.0.145.0	226.0.135.0	226.0.135.0	226.0.145.0
HPE Ethernet 10Gb 2-port 535T Adapter					
HPE Ethernet 10/25Gb 2-port 631FLR-SFP28 Adapter					
HPE Ethernet 10/25Gb 2-port 631SFP28 Adapter					
HPE Ethernet 10Gb 2-port 537SFP+ Adapter					
HPE Ethernet 10Gb 2-port 537SFP+ FLR Adapter					



Adapter					
HPE Ethernet 10Gb 2-port 537SFP+ FLR Adapter					

### **Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

### **Fixes**

- This product addressed the NC-SI passthrough algorithm for some FRU-reading commands from platform side.
- This product addressed the packet forwarding rule while receiving packet which is bigger than 9600 jumbo size.
- This product addressed the link failure under FreeBSD OS after changing link speed.
- This product addressed the failure of bringing up VFs of SRIOV when doing on and off switch.
- This product addressed adapter not responsive when work under heavy loading with 128 VMs.
- The product addressed status reporting of PLDM sensor monitoring with BMC.
- This product addressed the link-flap after link down or warm boot.

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 535FLR-T Adapter
- HPE Ethernet 10Gb 2-port 535T Adapter
- HPE Ethernet 10/25Gb 2-port 631FLR-SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 631SFP28 Adapter
- HPE Ethernet 10Gb 2-port 537SFP+ Adapter
- HPE Ethernet 10Gb 2-port 537SFP+ FLR Adapter

HPE Broadcom NetXtreme-E Online Firmware Upgrade Utility for VMware  
Version: 226.1.107.0 (B) **(Recommended)**  
Filename: CP065663.compsig; CP065663.zip

### **Important Note!**

HPE recommends *HPE Broadcom NetXtreme-E Drivers for VMware*, versions 2023.09.00 or later, for use with this firmware.

This software package contains NVM Image version 226.1.107000 with the following firmware versions:

NIC	Bootcode Version	NCSI Version	MBA Version	UEFI Version	RoCE Version
HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 OCP3 Adapter	226.0.145.0	226.0.145.0	226.0.135.0	226.0.135.0	226.0.145.0
HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 Adapter					
HPE Ethernet 10Gb 2-port BaseT BCM57416 OCP3 Adapter					
HPE Ethernet 10Gb 2-port BaseT BCM57416 Adapter					
HPE Ethernet 10Gb 2-port SFP+ BCM57412 OCP3 Adapter					
HPE Ethernet 10Gb 2-port SFP+ BCM57412 Adapter					
HPE Ethernet 10/25Gb 4-port SFP28 BCM57504 Adapter					
HPE Ethernet 10/25Gb 4-port SFP28 BCM57504 OCP3 Adapter					

### **Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

### **Fixes**

- This product addressed device lost symptom after continuously ungraceful restart on BCM57414 OCP3 adapter.

- This product addressed some RDE pattern format for some LLDP properties.
- This product addressed the NC-SI passthrough with BMC when device is under idle mode.
- This product addressed new mechanism for loading factory default.

### **Enhancements**

- This product enhanced the device self-diagnostic matrix and MAC verification.
- This product enhanced the link-speed calculation for internal variable.

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 OCP3 Adapter
- HPE Ethernet 10Gb 2-port BaseT BCM57416 Adapter
- HPE Ethernet 10Gb 2-port BaseT BCM57416 OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ BCM57412 Adapter
- HPE Ethernet 10Gb 2-port SFP+ BCM57412 OCP3 Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 BCM57414 Adapter
- Broadcom BCM57504 Ethernet 10/25Gb 4-port SFP28 Adapter for HPE
- Broadcom BCM57504 Ethernet 10/25Gb 4-port SFP28 OCP3 Adapter for HPE

---

HPE Broadcom NX1 Online Firmware Upgrade Utility VMware for HPE ProLiant Gen10 server series Only.

Version: 1.41.0 **(Recommended)**

Filename: CP064444.compsig; CP064444.zip

### **Important Note!**

- **This component ONLY support HPE ProLiant Gen10 server series.**

This software package contains combo image v20.32.41 with the following firmware versions:

<b>NIC</b>	<b>Boot Code Version</b>	<b>PXE Version</b>	<b>NCSI Version</b>	<b>UEFI Version</b>
HPE Ethernet 1Gb 2-port 330i Adapter (22BD)	2.10	21.6.4	1.5.60	21.6.85
HPE Ethernet 1Gb 4-port 331i Adapter (22BE) HPE Ethernet 1Gb 4-port 331FLR Adapter HPE Ethernet 1Gb 4-port 331T Adapter	1.60	21.6.4	1.5.60	21.6.85
HPE Ethernet 1Gb 2-port 332i Adapter (22E8) HPE Ethernet 1Gb 2-port 332T Adapter	1.43	21.6.4	1.5.60	21.6.85

For previous firmware versions prior to v20.19.51, please refer to the link : <https://www.hpe.com/global/swpublishing/MTX-4f19da2bceff4b73a31531d71e>

### **Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

### **Enhancements**

This product enhances libfwupg to improve NVRAM configuration updates.

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 1Gb 2-port 330i Adapter (22BD)
- HPE Ethernet 1Gb 4-port 331i Adapter (22BE)
- HPE Ethernet 1Gb 4-port 331FLR Adapter
- HPE Ethernet 1Gb 4-port 331T Adapter
- HPE Ethernet 1Gb 2-port 332i Adapter (22E8)
- HPE Ethernet 1Gb 2-port 332T Adapter

---

HPE Intel Online Firmware Upgrade Utility VMware for HPE ProLiant Gen9 and Gen10 server series Only.

Version: 3.25.0 (B) **(Recommended)**

Filename: CP065648.compsig; CP065648.zip

### **Important Note!**

- This software package contains the following firmware versions for the below listed supported network adapters:

NIC	EEPROM/NVM Version	OROM Version	Single NVM Version
HPE Ethernet 1Gb 2-port 361i Adapter	8000119A	1.3686.0	N/A
HPE Ethernet 1Gb 2-port 361T Adapter	80001147	1.3686.0	N/A
HPE Ethernet 1Gb 4-port 366FLR Adapter	800011A1	1.3686.0	N/A
HPE Ethernet 1Gb 4-port 366T Adapter	800011F1	1.3686.0	N/A
HPE Ethernet 1Gb 2-port 368i Adapter	80003AC5	1.3686.0	N/A
HPE Ethernet 1Gb 2-port 368FLR-MMT Adapter	80003AC2	1.3686.0	N/A
HPE Ethernet 1Gb 4-port 369i Adapter	80003AC3	1.3686.0	N/A
HPE Ethernet 10Gb 2-port 568i Adapter	80003AC4	1.3686.0	N/A
HPE Ethernet 10Gb 2-port 568FLR-MMSFP+ Adapter	80003AC2	1.3686.0	N/A
HPE Ethernet 10Gb 2-port 568FLR-MMT Adapter	80003AC2	1.3686.0	N/A
HPE Ethernet 10Gb 2-port 563i Adapter	800035C0	1.1375.0	N/A
HPE Ethernet 10Gb 2-port 562FLR-SFP+ Adapter	8000F231	1.3686.0	11.1.7
HPE Ethernet 10Gb 2-port 562FLR-T Adapter	800016F1	1.3686.0	10.55.3
HPE Ethernet 10Gb 2-port 562SFP+ Adapter	8000F232	1.3686.0	11.1.7
HPE Ethernet 10Gb 2-port 562T Adapter	800016EF	1.3686.0	10.55.3

The combo image v1.3686.0 includes: Boot Agent: 1GbE - v1.5.90, 10GbE - v2.4.54, 40GbE - v1.1.45 & UEFI Drivers: 1GbE - v9.8.62, 10GbE - v8.2.47, 40GbE - v5.0.12

Single NVM Version is new firmware format which represent an unified version in place of the previously used EEPROM/NVM Version or OROM version.

**This software package no longer contains Firmware for the below listed supported network adapters:**

HPE Ethernet 1Gb 2-port 363i Adapter  
HPE Ethernet 1Gb 4-port 366i Adapter  
HPE Ethernet 1Gb 4-port 366i Communication Board  
HPE Ethernet 10Gb 2-port 560FLR-SFP+ Adapter  
HPE Ethernet 10Gb 2-port 560SFP+ Adapter  
HPE Ethernet 10Gb 2-port 561FLR-T Adapter  
HPE Ethernet 10Gb 2-port 561T Adapter

- The latest firmware version of above adapters, please refer to the link : [https://support.hpe.com/connect/s/softwaredetails?language=en\\_US&softwareId=MTX\\_d7826493bb5a4aa69b4aa9a1d5&tab=releaseNotes](https://support.hpe.com/connect/s/softwaredetails?language=en_US&softwareId=MTX_d7826493bb5a4aa69b4aa9a1d5&tab=releaseNotes)

### **Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

### **Enhancements**

This product now supports VMware 9.0

### **Supported Devices and Features**

This package supports the following network adapters:

- HPE Ethernet 1Gb 2-port 361i Adapter
- HPE Ethernet 1Gb 2-port 361T Adapter
- HPE Ethernet 1Gb 2-port 368FLR-MMT Adapter
- HPE Ethernet 1Gb 2-port 368i Adapter
- HPE Ethernet 1Gb 4-port 366FLR Adapter
- HPE Ethernet 1Gb 4-port 366T Adapter
- HPE Ethernet 1Gb 4-port 369i Adapter
- HPE Ethernet 10Gb 2-port 562FLR-SFP+ Adapter
- HPE Ethernet 10Gb 2-port 562FLR-T Adapter
- HPE Ethernet 10Gb 2-port 562SFP+ Adapter
- HPE Ethernet 10Gb 2-port 562T Adapter
- HPE Ethernet 10Gb 2-port 568FLR-MMSFP+ Adapter
- HPE Ethernet 10Gb 2-port 568FLR-MMT Adapter
- HPE Ethernet 10Gb 2-port 568i Adapter
- HPE Ethernet 10Gb 2-port 563i Adapter

---

HPE QLogic FastLinQ Firmware Package for Arrowhead adapters

Version: 8.65.23 **(Recommended)**

Filename: ql\_hp\_ah\_mbi\_8.65.23\_pldm.fwpkg

### **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- HPE QLogic FastLinQ 10/25/50 GbE Drivers for Linux, version 8.74.6.0-x or later
- HPE QLogic FastLinQ 10/25/50 GbE Drivers for Microsoft Windows Server x64 Editions, version 8.72.21.0 or later
- HPE QLogic FastLinQ 10/25/50 GbE Multifunction Drivers for VMware, version 2025.03.00 or later

This software package contains combo image v8.65.23. This combo image includes: Boot Code (MFW): 8.65.7.0, PXE: 2.0.19, and UEFI: 4.1.13.2.

### **Enhancements**

This product enhanced the compatibility with drivers.

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 521T Adapter
- HPE Ethernet 10Gb 2-port 524SFP+ Adapter
- HPE Ethernet 10/25Gb 2-port 621SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 622FLR-SFP28 Adapter
- HPE StoreFabric CN1200R-T Converged Network Adapter
- HPE StoreFabric CN1300R Converged Network Adapter

---

HPE QLogic FastLinQ Online Firmware Upgrade Utility for VMware

Version: 4.20.0 **(Recommended)**

Filename: CP064261.compsig; CP064261.zip

### **Important Note!**

HPE recommends *HPE QLogic FastLinQ 10/25/50GbE Multifunction Drivers for VMware*, versions 2025.03.00 or later, for use with this firmware.

This software package contains combo image version v8.65.23 includes:

- Boot Code (MFW): 8.65.7.0
- UEFI: 4.1.13.2
- PXE: 2.0.19

The users will only see the combo image versions in the interactive mode firmware update or while using HPSUM/SPP to update the firmware on the supported adapters.

### **Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

### **Enhancements**

This product enhanced the compatibility with drivers.

**Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 521T Adapter
- HPE Ethernet 10Gb 2-port 524SFP+ Adapter
- HPE Ethernet 10/25Gb 2-port 621SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 622FLR-SFP28 Converged Network Adapter
- HPE StoreFabric CN1200R-T Converged Network Adapter
- HPE StoreFabric CN1300R Converged Network Adapter

---

HPE QLogic FastLinQ Online Firmware Upgrade Utility for VMware  
Version: 8.55.12 (B) **(Recommended)**  
Filename: CP065660.compsig; CP065660.zip

**Important Note!**

HPE recommends *HPE QLogic FastLinQ 10/25/50GbE Multifunction Drivers for VMware*, versions 2021.04.05 or later, for use with this firmware.

This software package contains combo image version v8.55.12 includes:

- Boot Code (MFW): 8.55.21.0
- UEFI: 4.1.11.2
- PXE: 2.0.19

The users will only see the combo image versions in the interactive mode firmware update or while using HPSUM/SPP to update the firmware on the supported adapters.

**Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

**Fixes**

This product addresses a pause flood condition on switch when attempting iPXE boot.

**Enhancements**

This product contains support PLDM firmware upgrade base improvements.

**Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 521T Adapter
- HPE Ethernet 10Gb 2-port 524SFP+ Adapter
- HPE Ethernet 10/25Gb 2-port 621SFP28 Adapter
- HPE Ethernet 10/25Gb 2-port 622FLR-SFP28 Converged Network Adapter
- HPE StoreFabric CN1200R-T Converged Network Adapter
- HPE StoreFabric CN1300R Converged Network Adapter

---

HPE QLogic NX2 Online Firmware Upgrade Utility for VMware  
Version: 1.37.0 **(Recommended)**  
Filename: CP064334.compsig; CP064334.zip

**Important Note!**

HPE recommends *HPE QLogic NX2 10/20GbE Multifunction Drivers for VMware*, versions 2025.03.00 or later, for use with this firmware.

This software package contains combo image v7.19.27 with the following firmware versions:

NIC	Boot Code Version	PXE Version	UEFI Version	iSCSI Version	FCoE Version	CCM Version	L2 Version
HPE Ethernet 10Gb 2-port 530SFP+ Adapter	7.16.15	7.14.13	8.9.3	n/a	n/a	7.14.4	7.12.25

HPE Ethernet 10Gb 2-port 530T Adapter							
HPE Ethernet 10Gb 2-port 533FLR-T Adapter HPE FlexFabric 10Gb 2-port 534FLR-SFP+ Adapter HPE FlexFabric 10Gb 4-port 536FLR-T Adapter	7.16.15	7.14.13	8.9.3	7.14.0	7.14.3	7.14.4	7.12.25

**Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

**Enhancements**

This product enhanced the compatibility with drivers.

**Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10Gb 2-port 530SFP+ Adapter
- HPE Ethernet 10Gb 2-port 530T Adapter
- HPE Ethernet 10Gb 2-port 533FLR-T Adapter
- HPE FlexFabric 10Gb 2-port 534FLR-SFP+ Adapter
- HPE FlexFabric 10Gb 4-port 536FLR-T Adapter

Intel Firmware Package For E810-2CQDA2 Ethernet 100Gb 2-port QSFP28 Adapter  
Version: 4.60 (B) **(Recommended)**  
Filename: HPE\_E810\_2CQDA2\_O\_SEC\_4p60\_PLDMoMCTP\_8001E8B6.fwpkg;  
HPE\_E810\_2CQDA2\_O\_SEC\_4p60\_PLDMoMCTP\_8001E8B6.json

**Important Note!**

- For Firmware installation, there is no OS and drivers dependency.  
For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,
- Intel icea Driver for Microsoft Windows Server, version 1.15.121.0 or later
  - Intel ice Drivers for Linux, version 1.15.4-1 or later
  - Intel icen Driver for VMware, version 2024.11.00 or later

This FW version does not support Port.Reset RDE metrics. This product will be enhance to improve the functions in the future release

**Enhancements**

Add new support platform.

**Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-2CQDA2 Ethernet 100Gb 2-port QSFP28 Adapter for HPE

Intel Firmware Package For E810-CQDA2 Ethernet 100Gb 2-port QSFP28 Adapter  
Version: 4.60 (B) **(Recommended)**  
Filename: HPE\_E810\_CQDA2\_4p60\_PLDMoMCTP\_8001E8B1.fwpkg; HPE\_E810\_CQDA2\_4p60\_PLDMoMCTP\_8001E8B1.json

**Important Note!**

- For Firmware installation, there is no OS and drivers dependency.  
For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,
- Intel icea Driver for Microsoft Windows Server, version 1.15.121.0 or later
  - Intel ice Drivers for Linux, version 1.15.4-1 or later

Intel icen Driver for VMware, version 2024.11.00 or later

This FW version does not support Port.Reset RDE metrics. This product will be enhance to improve the functions in the future release

### **Enhancements**

Add new support platform.

### **Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-CQDA2 Ethernet 100Gb 2-port QSFP28 Adapter for HPE

---

Intel Firmware Package For E810-CQDA2 Ethernet 100Gb 2-port QSFP28 OCP3 Adapter

Version: 4.60 (B) **(Recommended)**

Filename: HPE\_E810\_CQDA2\_OCP\_4p60\_NCsiwPLDMoMCTP\_8001E8B5.fwpkg;

HPE\_E810\_CQDA2\_OCP\_4p60\_NCsiwPLDMoMCTP\_8001E8B5.json

### **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Intel icea Driver for Microsoft Windows Server, version 1.15.121.0 or later
- Intel ice Drivers for Linux, version 1.15.4-1 or later
- Intel icen Driver for VMware, version 2024.11.00 or later

This FW version does not support Port.Reset RDE metrics. This product will be enhance to improve the functions in the future release

### **Enhancements**

Add new support platform.

### **Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-CQDA2 Ethernet 100Gb 2-port QSFP28 OCP3 Adapter for HPE

---

Intel Firmware Package For E810-XXVDA2 Ethernet 10/25Gb 2-port SFP28 Adapter

Version: 4.60 (B) **(Recommended)**

Filename: HPE\_E810\_XXVDA2\_SD\_4p60\_PLDMoMCTP\_8001E8B3.fwpkg; HPE\_E810\_XXVDA2\_SD\_4p60\_PLDMoMCTP\_8001E8B3.json

### **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Intel icea Driver for Microsoft Windows Server, version 1.15.121.0 or later
- Intel ice Drivers for Linux, version 1.15.4-1 or later
- Intel icen Driver for VMware, version 2024.11.00 or later

This FW version does not support Port.Reset RDE metrics. This product will be enhance to improve the functions in the future release

### **Enhancements**

Add new support platform.

### **Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-XXVDA2 Ethernet 10/25Gb 2-port SFP28 Adapter for HPE

---

Intel Firmware Package For E810-XXVDA2 Ethernet 10/25Gb 2-port SFP28 OCP3 Adapter

Version: 4.60 (B) **(Recommended)**

Filename: HPE\_E810\_XXVDA2\_SD\_OCP\_4p60\_NCSIwPLDMoMCTP\_8001E8B0.fwpkg;

HPE\_E810\_XXVDA2\_SD\_OCP\_4p60\_NCSIwPLDMoMCTP\_8001E8B0.json

### **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Intel icea Driver for Microsoft Windows Server, version 1.15.121.0 or later
- Intel ice Drivers for Linux, version 1.15.4-1 or later
- Intel icen Driver for VMware, version 2024.11.00 or later

This FW version does not support Port.Reset RDE metrics. This product will be enhance to improve the functions in the future release

### **Enhancements**

Add new support platform.

### **Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-XXVDA2 Ethernet 10/25Gb 2-port SFP28 OCP3 Adapter for HPE

---

Intel Firmware Package For E810-XXVDA4 Ethernet 10/25Gb 4-port SFP28 Adapter

Version: 4.60 (B) **(Recommended)**

Filename: HPE\_E810\_XXVDA4\_FH\_4p60\_PLDMoMCTP\_8001E8B2.fwpkg; HPE\_E810\_XXVDA4\_FH\_4p60\_PLDMoMCTP\_8001E8B2.json

### **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Intel icea Driver for Microsoft Windows Server, version 1.15.121.0 or later
- Intel ice Drivers for Linux, version 1.15.4-1 or later
- Intel icen Driver for VMware, version 2024.11.00 or later

This FW version does not support Port.Reset RDE metrics. This product will be enhance to improve the functions in the future release

### **Enhancements**

Add new support platform.

### **Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-XXVDA4 Ethernet 10/25Gb 4-port SFP28 Adapter for HPE

---

Intel Firmware Package For E810-XXVDA4 Ethernet 10/25Gb 4-port SFP28 OCP3 Adapter

Version: 4.60 (B) **(Recommended)**

Filename: HPE\_E810\_XXV4\_OCP\_4p60\_NCSIwPLDMoMCTP\_8001E8AF.fwpkg;

HPE\_E810\_XXV4\_OCP\_4p60\_NCSIwPLDMoMCTP\_8001E8AF.json

### **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,



- Intel icea Driver for Microsoft Windows Server, version 1.15.121.0 or later
- Intel ice Drivers for Linux, version 1.15.4-1 or later
- Intel icen Driver for VMware, version 2024.11.00 or later

This FW version does not support Port.Reset RDE metrics. This product will be enhance to improve the functions in the future release

**Enhancements**

Add new support platform.

**Supported Devices and Features**

This product supports the following network adapters:

- Intel E810-XXVDA4 Ethernet 10/25Gb 4-port SFP28 OCP3 Adapter for HPE

Intel Online Firmware Upgrade Utility for VMware  
Version: 3.25.0 (B) **(Recommended)**  
Filename: CP065653.compsig; CP065653.zip

**Important Note!**

This software package contains the following firmware versions for the below listed supported network adapters:

NIC	EEPROM/NVM Version	OROM Version	NVM Version
HPE Ethernet 10Gb 2-port SFP+ OCP3 X710-DA2 Adapter	8000F6CA	1.3682.0	9.52
HPE Ethernet 10Gb 2-port SFP+ X710-DA2 Adapter	8000F6C9	1.3682.0	9.52
Intel I350-T4 Ethernet 1Gb 4-port BASE-T Adapter	8000123F	1.3682.0	N/A
Intel I350-T4 Ethernet 1Gb 4-port BASE-T OCP3 Adapter	80001234	1.3682.0	N/A
Intel(R) I350 Gigabit Network Connection (2-port)	8000119C	1.3682.0	N/A
Intel(R) I350 Gigabit Network Connection (4-port)	8000119D	1.3682.0	N/A

The combo image v1.3682.0 includes: Boot Agent: 1GbE - v1.5.90, 10GbE - v2.4.54, 40GbE - v1.1.45 & UEFI Drivers: 1GbE - v9.8.62, 10GbE - v8.2.47, 40GbE - v5.0.12

Single NVM Version is new firmware format which represent an unified version in place of the previously used EEPROM/NVM Version or OROM version.

**Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

**Enhancements**

This product now supports VMware 9.0

**Supported Devices and Features**

This package supports the following network adapters:

- Intel(R) I350 Gigabit Network Connection (2-port)
- Intel(R) I350 Gigabit Network Connection (4-port)
- HPE Ethernet 1Gb 4-port BaseT I350-T4 Adapter
- HPE Ethernet 1Gb 4-port BaseT I350-T4 OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ X710-DA2 OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ X710-DA2 Adapter

Version: 8.65.21 (**Recommended**)  
Filename: ql\_ah\_mbi\_open\_8.65.21\_pldm.fwpkg

### **Important Note!**

For Firmware installation, there is no OS and drivers dependency.

For Firmware compatibility during production, HPE recommends the drivers for use with the firmware Package product as below,

- Marvell FastLinQ 10/25/50 GbE Drivers for Microsoft Windows Server x64 Editions, version 8.72.21.0 or later
- HPE QLogic FastLinQ 10/25/50 GbE Drivers for Linux, version 8.74.6.0-5 or later
- HPE QLogic FastLinQ 10/25/50 GbE Multifunction Drivers for VMware, version 2025.03.00 or later

### **Enhancements**

This product enhanced the compatibility with drivers.

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10/25Gb 2-port SFP28 QL41232HLCU Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 QL41232HVCU OCP3 Adapter
- HPE Ethernet 10Gb 2-port BaseT QL41132HLRJ Adapter
- HPE Ethernet 10Gb 2-port BaseT QL41132HQRJ OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ QL41132HLCU Adapter
- HPE Ethernet 10Gb 2-port SFP+ QL41132HVCU OCP3 Adapter
- HPE Ethernet 10Gb 4-port SFP+ QL41134HLCU Adapter

---

Marvell FastLinQ Online Firmware Upgrade Utility for VMware  
Version: 8.55.12 (B) (**Recommended**)  
Filename: CP065661.compsig; CP065661.zip

### **Important Note!**

This software package contains combo image v8.55.12. This combo image includes:

- PXE: 2.0.19
- Boot Code (MFW): 8.55.22.0
- UEFI: 6.1.8.2

### **Prerequisites**

This product requires the appropriate driver for your device and operating system be installed before firmware is updated.

### **Fixes**

- This product contains support PLDM firmware upgrade base improvements.
- This product addresses an overheat issue on the network adapters as below,

HPE Ethernet 10Gb 2-port BaseT QL41132HLRJ Adapter  
HPE Ethernet 10Gb 2-port BaseT QL41132HQRJ OCP3 Adapter

### **Enhancements**

This product now supported NPAR enabling option.

### **Supported Devices and Features**

This product supports the following network adapters:

- HPE Ethernet 10/25Gb 2-port SFP28 QL41232HVCU OCP3 Adapter
- HPE Ethernet 10/25Gb 2-port SFP28 QL41232HLCU Adapter
- HPE Ethernet 10Gb 4-port SFP+ QL41134HLCU Adapter
- HPE Ethernet 10Gb 2-port BaseT QL41132HLRJ Adapter
- HPE Ethernet 10Gb 2-port BaseT QL41132HQRJ OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ QL41132HVCU OCP3 Adapter
- HPE Ethernet 10Gb 2-port SFP+ QL41132HLCU Adapter

---

Mellanox Firmware Package (FWPKG) - Mellanox MCX631102AS-ADAT Ethernet 10/25Gb 2-port SFP28 Adapter for HPE

**Important Note!**

**Disclaimer:** Certain software including drivers and documents may be available from NVIDIA. If you select a URL that directs you to <http://www.nvidia.com/>, you are then leaving HPE.com. Please follow the instructions on <http://www.nvidia.com/> to download NVIDIA software or documentation. When downloading the NVIDIA software or documentation, you may be subject to NVIDIA terms and conditions, including licensing terms, if any, provided on its website or otherwise. HPE is not responsible for your use of any software or documents that you download from <http://www.nvidia.com/>, except that HPE may provide a limited warranty for NVIDIA software in accordance with the terms and conditions of your purchase of the HPE product or solution.

A list of known issues with this release is available

at: <https://docs.nvidia.com/networking/display/connectx6lxfirmwarev26431014/known+issues>

**Prerequisites**

FWPKG will work only if the firmware version flashed on the adapter is 20.27.1016 or later and iLO5 firmware version must be 2.30 or higher.

**Fixes****The following issues have been fixed in version 26.43.1014:**

- Setup crash would occur when create\_sq used invalid mbox. Now the invalid mbox is replaced with a valid DB.
- Fixed the query for FACTORY default NV configuration values. The firmware always returned the "next" value to be applied.

**Enhancements**

Security Hardening Enhancements: This release contains important reliability improvements and security hardening enhancements. HPE recommends upgrading your device's firmware to this release to improve the firmware security and reliability of your device.

**New features and changes included in version 26.43.1014:**

- Added a recovery step in case of CQ doorbell getting lost during VF migration.
- Added the option to indicate an error CQE event on every selected function per eSwitch manager. This indication is defined as a new WQE including the relevant information about the error (such as: syndrome, function\_id, timestamp, QPs num etc.). The feature is configured using a new general object: RDMA-Telemetry object, and depends on the following new caps:

HCA\_CAP.rdma\_telemetry\_notification\_types and HCA\_CAP.rdma\_telemetry.

- Extended kernel lockdown permission set. The following sub-operations can now be called by tools (permission TOOLS\_RESOURCES) using new HCA capability bitmask field: tool\_partial\_cap.

The 5 sub-operations are:

- QUERY\_HCA\_CAP with other function
- QUERY\_VUID with direct data
- QUERY\_ROCE\_ADDRESS with other vport
- SET\_HCA\_CAP with other function
- POSTPONE\_CONNECTED\_QP\_TIMEOUT with other vport

The new added caps are:

- tool\_partial\_cap.postpone\_conn\_qp\_timeout\_other\_vport,
- tool\_partial\_cap.set\_hca\_cap\_other\_func
- tool\_partial\_cap.query\_roce\_addr\_other\_vport
- tool\_partial\_cap.query\_vuid\_direct\_data
- tool\_partial\_cap.query\_hca\_cap\_other\_func
- Added 'table\_type\_valid' and 'table\_type' fields to the steering action (STC) "Jump To Flow" table parameters to enable the user to jump from NIC\_TX to FDB\_TX and bypass the ACL table.
- Enabled hop reduction by bypassing NIC domain in various use cases. Such action reduces the number of hops (improves PPS) to deal with mass number of flows and devices. To enable this new capability, a new STC action type "JUMP\_TO\_FDB\_RX" was added to allow jumping into the RX side of a table.

**Supported Devices and Features**

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
P42044-B21	Mellanox MCX631102AS-ADAT Ethernet 10/25Gb 2-port SFP28 Adapter for HPE	MT_0000000575

## Important Note!

**Disclaimer:** Certain software including drivers and documents may be available from NVIDIA. If you select a URL that directs you to <http://www.nvidia.com/>, you are then leaving HPE.com. Please follow the instructions on <http://www.nvidia.com/> to download NVIDIA software or documentation. When downloading the NVIDIA software or documentation, you may be subject to NVIDIA terms and conditions, including licensing terms, if any, provided on its website or otherwise. HPE is not responsible for your use of any software or documents that you download from <http://www.nvidia.com/>, except that HPE may provide a limited warranty for NVIDIA software in accordance with the terms and conditions of your purchase of the HPE product or solution.

A list of known issues with this release is available

at: <https://docs.nvidia.com/networking/display/connectx6lxfirmwarev26431014/known+issues>

## Prerequisites

FWPKG will work only if the firmware version flashed on the adapter is 20.27.1016 or later and iLO5 firmware version must be 2.30 or higher.

## Fixes

### The following issues have been fixed in version 26.43.1014:

- Setup crash would occur when create\_sq used invalid mbox. Now the invalid mbox is replaced with a valid DB.
- Fixed the query for FACTORY default NV configuration values. The firmware always returned the "next" value to be applied.

## Enhancements

**Security Hardening Enhancements:** This release contains important reliability improvements and security hardening enhancements. HPE recommends upgrading your device's firmware to this release to improve the firmware security and reliability of your device.

### New features and changes included in version 26.43.1014:

- Added a recovery step in case of CQ doorbell getting lost during VF migration.
- Added the option to indicate an error CQE event on every selected function per eSwitch manager. This indication is defined as a new WQE including the relevant information about the error (such as: syndrome, function\_id, timestamp, QPs num etc.). The feature is configured using a new general object: RDMA-Telemetry object, and depends on the following new caps:

HCA\_CAP.rdma\_telemetry\_notification\_types and HCA\_CAP.rdma\_telemetry.

- Extended kernel lockdown permission set. The following sub-operations can now be called by tools (permission TOOLS\_RESOURCES) using new HCA capability bitmask field: tool\_partial\_cap.

The 5 sub-operations are:

- QUERY\_HCA\_CAP with other function
- QUERY\_VUID with direct data
- QUERY\_ROCE\_ADDRESS with other vport
- SET\_HCA\_CAP with other function
- POSTPONE\_CONNECTED\_QP\_TIMEOUT with other vport

The new added caps are:

- tool\_partial\_cap.postpone\_conn\_qp\_timeout\_other\_vport,
- tool\_partial\_cap.set\_hca\_cap\_other\_func
- tool\_partial\_cap.query\_roce\_addr\_other\_vport
- tool\_partial\_cap.query\_vuid\_direct\_data
- tool\_partial\_cap.query\_hca\_cap\_other\_func
- Added 'table\_type\_valid' and 'table\_type' fields to the steering action (STC) "Jump To Flow" table parameters to enable the user to jump from NIC\_TX to FDB\_TX and bypass the ACL table.
- Enabled hop reduction by bypassing NIC domain in various use cases. Such action reduces the number of hops (improves PPS) to deal with mass number of flows and devices. To enable this new capability, a new STC action type "JUMP\_TO\_FDB\_RX" was added to allow jumping into the RX side of a table.

## Supported Devices and Features

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
-----------------	---------------------------------	------

Mellanox Firmware Package (FWPKG) for Mellanox MCX623105AS-VDAT Ethernet 200Gb 1-port QSFP56 Adapter for HPE  
Version: 22.43.1014 **(Recommended)**  
Filename: 22\_43\_1014-MCX623105AS-VDA\_Ax.pldm.fwpkg

### **Important Note!**

**Disclaimer:** Certain software including drivers and documents may be available from NVIDIA. If you select a URL that directs you to <http://www.nvidia.com/>, you are then leaving HPE.com. Please follow the instructions on <http://www.nvidia.com/> to download NVIDIA software or documentation. When downloading the NVIDIA software or documentation, you may be subject to NVIDIA terms and conditions, including licensing terms, if any, provided on its website or otherwise. HPE is not responsible for your use of any software or documents that you download from <http://www.nvidia.com/>, except that HPE may provide a limited warranty for NVIDIA software in accordance with the terms and conditions of your purchase of the HPE product or solution.

A list of known issues with this release is available

at: <https://docs.nvidia.com/networking/display/connectx6dxfirmwarev22431014/known+issues>

### **Prerequisites**

FWPKG will work only if the firmware version flashed on the adapter is 22.27.1016 or later and iLO5 firmware version must be 2.30 or higher.

### **Fixes**

#### **The following issues have been fixed in version 22.43.1014:**

- Setup crash would occur when create\_sq used invalid mbox. Now the invalid mbox is replaced with a valid DB.
- An upgrade issue that required firmware v22.36.1010 as an intermediate version when upgrading the firmware from v22.33.0428 or below to versions above 22.36.1010.
- Fixed the query for FACTORY default NV configuration values. The firmware always returned the "next" value to be applied.

### **Enhancements**

Security Hardening Enhancements: This release contains important reliability improvements and security hardening enhancements. HPE recommends upgrading your device's firmware to this release to improve the firmware security and reliability of your device.

#### **New features and changes included in version 22.43.1014:**

- Added a recovery step in case of CQ doorbell getting lost during VF migration.
- Added the option to indicate an error CQE event on every selected function per eSwitch manager. This indication is defined as a new WQE including the relevant information about the error (such as: syndrome, function\_id, timestamp, QPs num etc.). The feature is configured using a new general object: RDMA-Telemetry object, and depends on the following new caps:

HCA\_CAP.rdma\_telemetry\_notification\_types and HCA\_CAP.rdma\_telemetry .

- Extended kernel lockdown permission set. The following sub-operations can now be called by tools (permission TOOLS\_RESOURCES) using new HCA capability bitmask field: tool\_partial\_cap.

The 5 sub-operations are:

- QUERY\_HCA\_CAP with other function
- QUERY\_VUID with direct data
- QUERY\_ROCE\_ADDRESS with other vport
- SET\_HCA\_CAP with other function
- POSTPONE\_CONNECTED\_QP\_TIMEOUT with other vport

The new added caps are:

- tool\_partial\_cap.postpone\_conn\_qp\_timeout\_other\_vport,
- tool\_partial\_cap.set\_hca\_cap\_other\_func
- tool\_partial\_cap.query\_roce\_addr\_other\_vport
- tool\_partial\_cap.query\_vuid\_direct\_data
- tool\_partial\_cap.query\_hca\_cap\_other\_func
- Added 'table\_type\_valid' and 'table\_type' fields to the steering action (STC) "Jump To Flow" table parameters to enable the user to jump from NIC\_TX to FDB\_TX and bypass the ACL table.
- Enabled hop reduction by bypassing NIC domain in various use cases. Such action reduces the number of hops (improves PPS) to deal with mass number of flows and devices. To enable this new capability, a new STC action type "JUMP\_TO\_FDB\_RX" was added to allow jumping into the RX side of a table.
- Added support for QoS scheduling across multiple E-Switches grouped in a LAG. VPort members of a Physical Function can be

- added to a rate group from another Physical Function and rate limits of the group will apply to those VPort members as well.
- Increased the maximum number of supported "ARC-IN" from 1 to 8 and "ARCOUT" from 3 to 8 for the dynamic flex parser.

## **Supported Devices and Features**

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
P10180-B21	Mellanox MCX623105AS-VDAT Ethernet 200Gb 1-port QSFP56 Adapter for HPE	MT_0000000435

---

Mellanox Firmware Package (FWPKG) for Mellanox MCX623106AS-CDAT Ethernet 100Gb 2-port QSFP56 Adapter for HPE  
Version: 22.43.1014 **(Recommended)**  
Filename: 22\_43\_1014-MCX623106AS-CDA\_Ax.pldm.fwpgk; 22\_43\_1014-MCX623106AS-CDA\_Ax.pldm.json

## **Important Note!**

**Disclaimer:** Certain software including drivers and documents may be available from NVIDIA. If you select a URL that directs you to <http://www.nvidia.com/>, you are then leaving HPE.com. Please follow the instructions on <http://www.nvidia.com/> to download NVIDIA software or documentation. When downloading the NVIDIA software or documentation, you may be subject to NVIDIA terms and conditions, including licensing terms, if any, provided on its website or otherwise. HPE is not responsible for your use of any software or documents that you download from <http://www.nvidia.com/>, except that HPE may provide a limited warranty for NVIDIA software in accordance with the terms and conditions of your purchase of the HPE product or solution.

A list of known issues with this release is available  
at: <https://docs.nvidia.com/networking/display/connectx6dxfirmwarev22431014/known+issues>

## **Prerequisites**

FWPKG will work only if the firmware version flashed on the adapter is 22.27.1016 or later and iLO5 firmware version must be 2.30 or higher.

## **Fixes**

### **The following issues have been fixed in version 22.43.1014:**

- Setup crash would occur when create\_sq used invalid mbox. Now the invalid mbox is replaced with a valid DB.
- An upgrade issue that required firmware v22.36.1010 as an intermediate version when upgrading the firmware from v22.33.0428 or below to versions above 22.36.1010.
- Fixed the query for FACTORY default NV configuration values. The firmware always returned the "next" value to be applied.

## **Enhancements**

Security Hardening Enhancements: This release contains important reliability improvements and security hardening enhancements. HPE recommends upgrading your device's firmware to this release to improve the firmware security and reliability of your device.

### **New features and changes included in version 22.43.1014:**

- Added a recovery step in case of CQ doorbell getting lost during VF migration.
- Added the option to indicate an error CQE event on every selected function per eSwitch manager. This indication is defined as a new WQE including the relevant information about the error (such as: syndrome, function\_id, timestamp, QPs num etc.). The feature is configured using a new general object: RDMA-Telemetry object, and depends on the following new caps:  
HCA\_CAP.rdma\_telemetry\_notification\_types and HCA\_CAP.rdma\_telemetry .
- Extended kernel lockdown permission set. The following sub-operations can now be called by tools (permission TOOLS\_RESOURCES) using new HCA capability bitmask field: tool\_partial\_cap.  
The 5 sub-operations are:
  - QUERY\_HCA\_CAP with other function
  - QUERY\_VUID with direct data
  - QUERY\_ROCE\_ADDRESS with other vport
  - SET\_HCA\_CAP with other function
  - POSTPONE\_CONNECTED\_QP\_TIMEOUT with other vport

The new added caps are:

- tool\_partial\_cap.postpone\_conn\_qp\_timeout\_other\_vport,
- tool\_partial\_cap.set\_hca\_cap\_other\_func
- tool\_partial\_cap.query\_roce\_addr\_other\_vport
- tool\_partial\_cap.query\_vuid\_direct\_data
- tool\_partial\_cap.query\_hca\_cap\_other\_func
- Added 'table\_type\_valid' and 'table\_type' fields to the steering action (STC) "Jump To Flow" table parameters to enable the user to jump from NIC\_TX to FDB\_TX and bypass the ACL table.
- Enabled hop reduction by bypassing NIC domain in various use cases. Such action reduces the number of hops (improves PPS) to deal with mass number of flows and devices. To enable this new capability, a new STC action type "JUMP\_TO\_FDB\_RX" was added to allow jumping into the RX side of a table.
- Added support for QoS scheduling across multiple E-Switches grouped in a LAG. VPort members of a Physical Function can be added to a rate group from another Physical Function and rate limits of the group will apply to those VPort members as well.
- Increased the maximum number of supported "ARC-IN" from 1 to 8 and "ARCOUT" from 3 to 8 for the dynamic flex parser.

### **Supported Devices and Features**

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
P25960-B21	Mellanox MCX623106AS-CDAT Ethernet 100Gb 2-port QSFP56 Adapter for HPE	MT_0000000437

---

Mellanox Firmware Package(FWPKG) for HPE NV60025M Ethernet 10/25Gb 2-port Secure Network Adapter

Version: 26.43.1014 **(Recommended)**

Filename: 26\_43\_1014-S2A69-63001\_Ax\_header.pldm.fwpkg

### **Prerequisites**

FWPKG will work only if the firmware version flashed on the adapter is 22.27.1016 or later and iLO5 firmware version must be 2.30 or higher.

### **Enhancements**

Upgraded to version 26.43.1014

### **Supported Devices and Features**

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
P46603-B21	HPE NV60025M Ethernet 10/25Gb 2-port Secure Network Adapter	HPE0000000062

---

Mellanox Firmware Package(FWPKG) for HPE NV60100M 100Gb 2-port Storage Offload Adapter

Version: 22.43.1014 **(Recommended)**

Filename: 22\_43\_1014-R8M41-63001\_Ax\_header.pldm.fwpkg

### **Prerequisites**

FWPKG will work only if the firmware version flashed on the adapter is 22.27.1016 or later and iLO5 firmware version must be 2.30 or higher.

### **Enhancements**

Upgraded to version 22.43.1014

### **Supported Devices and Features**

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
P46603-B21	HPE NV60100M 100Gb 2-port Storage Offload Adapter	HPE0000000062

NVIDIA Firmware Package (FWPKG) for HPE InfiniBand NDR200/Ethernet 200Gb 1-port OSFP PCIe5 x16 MCX75310AAS-HEAT Adapter :  
HPE part numbers P45642-B22 and P45642-H22  
Version: 28.44.1036 (**Recommended**)  
Filename: 28\_44\_1036-MCX75310AAS-HEAT\_HPE2\_Ax.pldm.fwpkg; 28\_44\_1036-MCX75310AAS-HEAT\_HPE2\_Ax.pldm.json

### **Important Note!**

For PLDM enabled VPI (Virtual Protocol Interconnect) adapters supporting both InfiniBand mode and Ethernet modes, every firmware version is made available in two different formats at HPE.com:

1. HPE signed PLDM Firmware Package (.FWPKG filename extension) updatable via iLO.
2. Firmware binary (.bin filename extension) updatable via mstflint utility from the Operating System.

Choose the appropriate firmware file format based on your preference and what suits your environment.

**Disclaimer:** Certain software including drivers and documents may be available from NVIDIA. If you select a URL that directs you to <http://www.nvidia.com/>, you are then leaving HPE.com. Please follow the instructions on <http://www.nvidia.com/> to download NVIDIA software or documentation. When downloading the NVIDIA software or documentation, you may be subject to NVIDIA terms and conditions, including licensing terms, if any, provided on its website or otherwise. HPE is not responsible for your use of any software or documents that you download from <http://www.nvidia.com/>, except that HPE may provide a limited warranty for NVIDIA software in accordance with the terms and conditions of your purchase of the HPE product or solution.

A list of known issues with this release is available at: <https://docs.nvidia.com/networking/display/connectx7firmwarev28441036/known+issues>

### **Prerequisites**

FWPKG will work only if the iLO5 firmware version is 2.30 or higher.

### **Fixes**

**The following issues have been fixed in version 28.44.1036:**

- Cable info semaphore deadlock.
- Improper error handling for the TLV full list, which caused the TLV mechanism to hang.
- The SPDM GET\_CERTIFICATE operation did not support all certificate chain offsets and chunk sizes.
- An issue in VDPA where destroying a virtq would cause a health buffer syndrome with ext\_synd=0x8f33 if the virtq was created without an mkey or with unmanned and mapped mkeys during live migration.
- The VDPA feature bits GUEST\_TSO4 and GUEST\_TSO6 were unexpectedly set by default, leading to traffic interruptions.
- Enabling PCC NP and setting the link type to one port as IB and the other as Ethernet could cause an assert to appear in dmesg with ext\_synd 0x8309.

### **Enhancements**

**New features and changes included in version 28.44.1036:**

- Increased the RX lossless buffer size to delay the transmission of Pause/PFC frames during NIC congestion.
- Added support for SyncE at 1G link speed.
- Added a new mechanism for allocations and deallocations flows to enhance parallelism.
- When using a multi-host deployment, each host is assigned unique ports and PFs and manages its own LAG.
- Added support for a new synchronized flow, including a tool and driver, to perform a fwreset on setups with a PCIe switch configuration.
- Unified PTP is now supported across different VFs on the same PF.
- Added support for new MADs: PortRecoveryPolicyConfig and PortRecoveryPolicyCounters . During the PHY recovery process, the firmware core will indicate the port\_logical\_state as Active.
- Added a new NV config (SM\_DISABLE, default 0) which, when enabled, blocks SMP traffic that does not originate from the SM.
- Added the ability to set cable length as a parameter in the PFCC access register. The cable length is used in the calculation of RX lossless buffer parameters, including size, Xoff, and Xon thresholds.

### **Supported Devices and Features**

HPE Part Number	Mellanox InfiniBand Only Adapter	PSID
P45642-B22	HPE InfiniBand NDR200/Ethernet 200Gb 1-port OSFP PCIe5 x16 MCX75310AAS-HEAT Adapter (P45642-B22 and P45642-H22)	MT_0000001119



---

Online Firmware Upgrade Utility (ESXi 9.0) for HPE Ethernet 10Gb 2-port 548SFP+ Adapter  
Version: 1.0.0 **(Recommended)**  
Filename: CP064990.compsig; CP064990.zip

### **Prerequisites**

Use iLO5 firmware version 2.30 or higher with ConnectX4-Lx firmware version 14.32.1010. Thermal sensor reporting on the adapter will not be functional with older versions of iLO5 firmware.

### **Fixes**

**No fixes have been included in firmware version 14.32.1900.**

### **Enhancements**

**Firmware for the following device has been updated to 14.32.1900:**

- P11338-B21 (HPE Ethernet 10Gb 2-port 548SFP+ Adapter)

#### **Security Hardening Enhancements**

This release contains important reliability improvements and security hardening enhancements. NVIDIA recommends upgrading your devices firmware to this release to improve the devices' firmware security and reliability.

**No new features or changes have been included in firmware version 14.32.1900.**

### **Supported Devices and Features**

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
P11338-B21	HPE Ethernet 10Gb 2-port 548SFP+ Adapter	HPE0000000038

---

Online Firmware Upgrade Utility (ESXi 9.0) for HPE Mellanox Ethernet only adapters  
Version: 1.0.0 **(Recommended)**  
Filename: CP064939.compsig; CP064939.zip

### **Important Note!**

The Firmware Upgrade Utility has been split into 2 packages for Mellanox Ethernet Only NIC adapters, one supporting Synergy platforms and the other supporting ProLiant and Apollo platforms. This package supports Mellanox Ethernet Only NIC adapters on ProLiant and Apollo servers.

### **Prerequisites**

Use iLO5 firmware version 2.30 or higher with ConnectX4-Lx/ConnectX5 firmware version 14.32.1010/16.32.1010 (or later) respectively. Thermal sensor reporting on the adapter will not be functional with older versions of iLO5 firmware.

### **Fixes**

**No fixes have been included in firmware version 14.32.1900.**

**The following issues have been fixed in firmware version 16.35.4030:**

- VF FLR would get stuck when its PF triggered the FLR as well.
- Unexpected source UDP port appeared in RoCE packets when the firmware ignored a non-PF driver configuration for RoCE source UDP port control (as set in SET\_HCA\_CAP.sw\_r\_roce\_src\_udp\_port).

### **Enhancements**

**Firmware for the following devices has been updated to 14.32.1900:**

- 817749-B21 (HPE Ethernet 25Gb 2-port 640FLR-SFP28 Adapter)
- 817753-B21 (HPE Ethernet 25Gb 2-port 640SFP28 Adapter)

**Firmware for the following device has been updated to 16.35.4030:**

- 874253-B21 (HPE Ethernet 100Gb 1-port 842QSFP28 Adapter)

**Security Hardening Enhancements**

This release contains important reliability improvements and security hardening enhancements. NVIDIA recommends upgrading your devices firmware to this release to improve the devices' firmware security and reliability.

**No new features or changes have been included in firmware version 14.32.1900.****New features and changes included in firmware version 16.35.4030:**

- Added support for postponing QP timeout "retry exceeded" errors for traffic directed at specific destinations. This new capability prevents broken connections for destinations in downtime because of live migration.

**Supported Devices and Features**

HPE Part Number	Mellanox Ethernet Only Adapters	PSID
817749-B21	HPE Ethernet 25Gb 2-port 640FLR-SFP28 Adapter	HP_2690110034
817753-B21	HPE Ethernet 25Gb 2-port 640SFP28 Adapter	HP_2420110034
874253-B21	HPE Ethernet 100Gb 1-port 842QSFP28 Adapter	HPE0000000014

---

Online Firmware Upgrade Utility (ESXi 9.0) for HPE Mellanox VPI (Ethernet and Infiniband mode) ConnectX4 and ConnectX5 devices on VMware ESXi 9.0

Version: 1.0.0 **(Recommended)**

Filename: CP064992.compsig; CP064992.zip

**Fixes****No new fixes have been added in version 12.28.2302.****The following issues have been fixed in version 16.35.4030:**

- VF FLR would get stuck when its PF triggered the FLR as well.
- Unexpected source UDP port appeared in RoCE packets when the firmware ignored a non-PF driver configuration for RoCE source UDP port control (as set in SET\_HCA\_CAP.sw\_r\_roce\_src\_udp\_port).

**Enhancements****Firmware for the following devices has been updated to 12.28.2302:**

- 825110-B21 (HPE InfiniBand EDR/Ethernet 100Gb 1-port 840QSFP28 Adapter)
- 825111-B21 (HPE InfiniBand EDR/Ethernet 100Gb 2-port 840QSFP28 Adapter)

**Firmware for the following devices has been updated to 16.35.4030:**

- 879482-B21 (HPE InfiniBand FDR/Ethernet 40/50Gb 2-port 547FLR-QSFP Adapter)
- 872726-B21 (HPE InfiniBand EDR/Ethernet 100Gb 2-port 841QSFP28 Adapter)

Important : Security Hardening Enhancements - This release contains important reliability improvements and security hardening enhancements. HPE recommends upgrading your device firmware to this version to improve the firmware security and reliability of your device.

**No new Features and changes included in version 12.28.2302.****New features and changes included in version 16.35.4030:**

- Added support for postponing QP timeout "retry exceeded" errors for traffic directed at specific destinations. This new capability prevents broken connections for destinations in downtime because of live migration.

**Supported Devices and Features**

HPE Part Number	Device Name	PSID
825110-B21	HPE InfiniBand EDR/Ethernet 100Gb 1-port 840QSFP28 Adapter	HP_2180110032
825111-B21	HPE InfiniBand EDR/Ethernet 100Gb 2-port 840QSFP28 Adapter	HP_2190110032
872726-B21	HPE InfiniBand EDR/Ethernet 100Gb 2-port 841QSFP28 Adapter	HPE0000000009
879482-B21	HPE InfiniBand FDR/Ethernet 40/50Gb 2-port 547FLR-QSFP Adapter	HPE0000000022

### **Important Note!**

**ConnectX-6 VPI supports having one port as InfiniBand and the other port as Ethernet according to the following matrix of combinations.**

Port #2 - InfiniBand				
Port #1 - Ethernet	HDR/HDR100	EDR	FDR	QDR
200GbE/50GbE	supported	not supported	not supported	supported
100GbE/25GbE	supported	not supported	not supported	supported
40GbE/10GbE	supported	not supported	not supported	supported
1GbE	supported	not supported	not supported	supported

Port #2 - Ethernet				
Port #1 - InfiniBand	200GbE/50GbE	100GbE/25GbE	40GbE/10GbE	1GbE
HDR / HDR100	supported	supported	not supported	supported
EDR	supported	supported	not supported	supported
FDR	not supported	not supported	not supported	not supported
QDR/SDR	supported	supported	not supported	supported

### **Prerequisites**

Use iLO5 firmware version 2.30 or higher with ConnectX6 firmware version 20.32.1010. Thermal sensor reporting on the adapter will not be functional with older versions of iLO5 firmware.

### **Fixes**

**The following issues have been fixed in version 20.43.1014:**

- Setup crash when "create\_sq" used invalid mbox.
- The firmware always returned the "next" value to be applied when querying FACTORY default NV configuration values.

### **Enhancements**

**Firmware for the following devices has been updated to 20.43.1014:**

- HPE InfiniBand HDR/Ethernet 200Gb 1-port QSFP56 PCIe3 x16 MCX653105A-HDAT Adapter - P06154-B21
- HPE InfiniBand HDR100/Ethernet 100Gb 1-port QSFP56 PCIe3 x16 MCX653105A-ECAT Adapter - P06250-B21
- HPE InfiniBand HDR100/Ethernet 100Gb 2-port QSFP56 PCIe3 x16 MCX653106A-ECAT Adapter - P06251-B21

Security Hardening Enhancements: This release contains important reliability improvements and security hardening enhancements. HPE recommends upgrading your device's firmware to this release to improve the firmware security and reliability of your device.

**New features and changes included in version 20.43.1014:**

- Added the option to indicate an error CQE event on every selected function per eSwitch manager. This indication is defined as a new WQE including the relevant information about the error (such as: syndrome, function\_id, timestamp, QPs num etc.).
- Extended kernel lockdown permission set. The following sub-operations can now be called by tools (permission TOOLS\_RESOURCES) using new HCA capability bitmask field: tool\_partial\_cap.

The 5 sub-operations are:

- QUERY\_HCA\_CAP with other function
- QUERY\_VUID with direct data
- QUERY\_ROCE\_ADDRESS with other vport
- SET\_HCA\_CAP with other function
- POSTPONE\_CONNECTED\_QP\_TIMEOUT with other vport

The new added caps are:

- tool\_partial\_cap.postpone\_conn\_qp\_timeout\_other\_vport,

- tool\_partial\_cap.set\_hca\_cap\_other\_func
- tool\_partial\_cap.query\_roce\_addr\_other\_vport
- tool\_partial\_cap.query\_vuid\_direct\_data
- tool\_partial\_cap.query\_hca\_cap\_other\_func

## **Supported Devices and Features**

<b>HPE Part Number</b>	<b>Device Name</b>	<b>PSID</b>
P06154-B21	HPE InfiniBand HDR/Ethernet 200Gb 1-port QSFP56 PCIe3 x16 MCX653105A-HDAT Adapter	HPE0000000034
P06250-B21	HPE InfiniBand HDR100/Ethernet 100Gb 1-port QSFP56 PCIe3 x16 MCX653105A-ECAT Adapter	HPE0000000035
P06251-B21	HPE InfiniBand HDR100/Ethernet 100Gb 2-port QSFP56 PCIe3 x16 MCX653106A-ECAT Adapter	HPE0000000036

Online Firmware Upgrade Utility (ESXi 9.0) for Mellanox Open Ethernet cards

Version: 1.0.0 (**Recommended**)

Filename: CP064970.compsig; CP064970.zip

## **Important Note!**

On Adapter Firmware rewrite scenario, SUM will always discover the Mellanox Open adapter firmware smart component as applicable and select it for deployment If the server iLO5 firmware version is older than 2.30.

## **Prerequisites**

Use iLO5 firmware version 2.30 or higher with ConnectX4-Lx/ConnectX5 firmware version 14.32.1010/16.32.1010 respectively. Thermal sensor reporting on the adapter will not be functional with older versions of iLO5 firmware.

## **Fixes**

**No fixes have been included in firmware version 14.32.1900.**

**The following issues have been fixed in firmware version 16.35.4030:**

- VF FLR would get stuck when its PF triggered the FLR as well.
- Unexpected source UDP port appeared in RoCE packets when the firmware ignored a non-PF driver configuration for RoCE source UDP port control (as set in SET\_HCA\_CAP.sw\_r\_roce\_src\_udp\_port).

## **Enhancements**

**Firmware for the following devices has been updated to 14.32.1900:**

- P21930-B21 (HPE Ethernet 10Gb 2-port SFP+ MCX4121A-XCAT Adapter)
- P11341-B21 (HPE Ethernet 10Gb 2-port SFP+ MCX4621A-ACAB OCP3 Adapter)

**Firmware for the following device has been updated to 16.35.4030:**

- P21927-B21 (HPE Ethernet 100Gb 2-Port QSFP28 MCX516A-CCHT Adapter)

## **Security Hardening Enhancements**

This release contains important reliability improvements and security hardening enhancements. NVIDIA recommends upgrading your devices firmware to this release to improve the devices' firmware security and reliability.

**No new features or changes have been included in firmware version 14.32.1900.**

**New features and changes included in firmware version 16.35.4030:**

- Added support for postponing QP timeout "retry exceeded" errors for traffic directed at specific destinations. This new capability prevents broken connections for destinations in downtime because of live migration.

## **Supported Devices and Features**

<b>HPE Part Number</b>	<b>Mellanox Ethernet Only Adapters</b>	<b>PSID</b>

P21930-B21	HPE Ethernet 10Gb 2-port SFP+ MCX4121A-XCHT Adapter	MT_0000000414
P11341-B21	HPE Ethernet 10Gb/25Gb 2-port SFP28 MCX4621A-ACAB OCP3 Adapter	MT_0000000238
P21927-B21	HPE Ethernet 100Gb 2-port QSFP28 MCX516A-CCHT Adapter	MT_0000000417

## Firmware - Storage Controller

[Top](#)

Controller Firmware Flash for ESXi8.0 and 9.0 - HPE MR216i-a Gen10 Plus Tri Mode Controller

Version: 52.26.3.5487 (B) **(Recommended)**

Filename: CP066014.compsig; CP066014.zip

### Enhancements

- Support VMware ESXi 9.0.

Controller Firmware Flash for ESXi8.0 and 9.0 - HPE MR216i-p Gen10 Plus Tri Mode Controller

Version: 52.26.3.5487 (B) **(Recommended)**

Filename: CP066015.compsig; CP066015.zip

### Enhancements

Support VMware ESXi 9.0.

Controller Firmware Flash for ESXi8.0 and 9.0 - HPE MR416i-a Gen10 Plus Tri Mode Controller

Version: 52.26.3.5487 (B) **(Recommended)**

Filename: CP066016.compsig; CP066016.zip

### Enhancements

Support VMware ESXi 9.0.

Controller Firmware Flash for ESXi8.0 and 9.0 - HPE MR416i-p Gen10 Plus Tri Mode Controller

Version: 52.26.3.5487 (B) **(Recommended)**

Filename: CP066017.compsig; CP066017.zip

### Enhancements

Support VMware ESXi 9.0.

Firmware Package - HPE Smart Array P408i-p, P408e-p, P408i-a, P408i-c, E208i-p, E208e-p, E208i-c, E208i-a, P204i-c, P416ie-m and P816i-a SR Gen10 and SR308i-o, SR308i-p Gen11 controllers

Version: 7.43 **(Recommended)**

Filename: HPE\_SR\_Gen10\_7.43\_A.fwpkg

### Enhancements

SR 2.9.2 patch 1

Firmware Package - HPE Gen11 Boot Controller NS204i-u, NS204i-d and HPE Gen10 Plus Boot Controller NS204i-p, NS204i-d, NS204i-t, NS204i-r

Version: 1.2.14.1018 (C) **(Recommended)**

Filename: HPE\_NS204i\_Gen10p\_Gen11\_1.2.14.1018\_C.fwpkg; HPE\_NS204i\_Gen10p\_Gen11\_1.2.14.1018\_C.json

### Important Note!

**1.2.14.1018 is the minimum firmware requirement for AMD Turin DL365/385 and Intel Gen12 platforms. Downgrading NS204i firmware to version lower than 1018 will lead to MCTP failure.**

**For Gen10 plus server users, the NS204i firmware has to be 1.0.14.1063 or later in order to enable PLDM firmware update functionality for the controller. Please find the smart component versions of 1.0.14.1063 in below link:**

- Windows: <https://www.hpe.com/global/swpublishing/MTX-be195b2891724ec8bb72c8bb2>
- Linux: <https://www.hpe.com/global/swpublishing/MTX-269e14d0e2524277bf699f433>
- Vmware: <https://www.hpe.com/global/swpublishing/MTX-1ffaca997cf248cd9f832a04c6>

## **Prerequisites**

- iLO 6 version 1.10 or later is required for Gen11 servers.
- iLO 5 version 2.81 or later is required for Gen10/Gen10 Plus servers

## **Enhancements**

- Support new servers.

---

HPE D3600/D3700/D3610/D3710 12Gb SAS Disk Enclosure ROM Flash Component for VMware (ESXi)

Version: 5.04 (K) (**Recommended**)

Filename: clean\_temp/\_obj\_data\_output\_64bit.txt; clean\_temp/Config.xml; clean\_temp/CP064954.tgz; clean\_temp/CP064954.vmcfg; clean\_temp/CP064954.vmexe64; clean\_temp/CP064954.vmfile; clean\_temp/CP064954.xml; clean\_temp/Generate\_VMexe.o; clean\_temp/i\_SKIP\_LINE.txt; clean\_temp/my\_md5sum\_info\_obj.o; clean\_temp/my\_scexe\_script.sh; clean\_temp/my\_scexe\_script\_obj.o; clean\_temp/obj\_data\_output\_bits.txt; clean\_temp/original\_scexe\_md5sum.txt; clean\_temp/tarball\_md5sum.txt; clean\_temp/tarball\_md5sum\_info\_obj.o; clean\_temp/the\_final\_zip/Config.xml; clean\_temp/the\_final\_zip/CP064954.vmcfg; clean\_temp/the\_final\_zip/CP064954.vmexe64; clean\_temp/the\_final\_zip/CP064954.vmfile; clean\_temp/the\_final\_zip/CP064954.xml; clean\_temp/the\_final\_zip/README.txt; clean\_temp/vmfile\_md5sum.txt; clean\_temp/vmfile\_md5sum\_info\_obj.o; clean\_temp/x\_Generate\_VMware\_compile.txt; CP064954.compsig; CP064954.md5; CP064954.zip

## **Important Note!**

**IMPORTANT:** Firmware updates must be performed during a system maintenance window, with all I/O to the system halted. In single domain configuration, if user hosts an OS in D3000(or any storage box) and flash the SEPs, it will hang/crash everytime as SmartComponent will reset the SEPs after flash/codeload.

**WARNING!** Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

**NOTE:** All firmware flash progress messages are logged to /var/cpq/D3000.log and flash summary is logged to /var/cpq/Component.log.

## **Prerequisites**

**IMPORTANT:** Firmware updates must be performed during a system maintenance window, with all I/O to the system halted.

**WARNING!** Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

**NOTE:** All firmware flash progress messages are logged to /var/cpq/D3000.log and flash summary is logged to /var/cpq/Component.log.

## **Fixes**

**The following fixes were incorporated in this version:**

- The Enabled-ClusterS2D command now completes successfully when executed on a SATA drive within a D3610 disk enclosure for a NonStop solution.
- The smart carrier, which is the drive case for SAS drives, now authenticates in the D3610/D3710 drive enclosure.
- Added new 7-segment error codes E0 and E1 to report issues with Fan modules A and B, respectively. These new codes only apply to the D3610/D3710 and only display when running firmware 5.04.
- If the storage enclosure processor within the I/O module fails, a hard reset (power down and then power up) is executed to ensure the processor comes back online.

Please refer to the [Release Notes](#) for the complete listing of fixes, enhancements, known issues and work-arounds corresponding to this firmware.

## **Enhancements**

Added support of ESXi 9.0

Removed support of ESXi 7.0

## **Supported Devices and Features**

The D3600 / D3700 / D3610 / D3710 Enclosure can be attached to any of the following HPE Storage Controllers and Host Bus Adapters :

- Smart Array P408e-p Controller

- Smart Array E208e-p Controller

---

HPE D3610B/D3710B 12Gb SAS Disk Enclosure ROM Flash Component for VMware (ESXi)

Version: 6.00 (E) **(Recommended)**

Filename: clean\_temp/\_obj\_data\_output\_64bit.txt; clean\_temp/Config.xml; clean\_temp/CP064957.tgz; clean\_temp/CP064957.vmcfg; clean\_temp/CP064957.vmxex64; clean\_temp/CP064957.vmfile; clean\_temp/CP064957.xml; clean\_temp/Generate\_VMexe.o; clean\_temp/i\_SKIP\_LINE.txt; clean\_temp/my\_md5sum\_info\_obj.o; clean\_temp/my\_scexe\_script.sh; clean\_temp/my\_scexe\_script\_obj.o; clean\_temp/obj\_data\_output\_bits.txt; clean\_temp/original\_scexe\_md5sum.txt; clean\_temp/tarball\_md5sum.txt; clean\_temp/tarball\_md5sum\_info\_obj.o; clean\_temp/the\_final\_zip/Config.xml; clean\_temp/the\_final\_zip/CP064957.vmcfg; clean\_temp/the\_final\_zip/CP064957.vmxex64; clean\_temp/the\_final\_zip/CP064957.vmfile; clean\_temp/the\_final\_zip/CP064957.xml; clean\_temp/the\_final\_zip/README.txt; clean\_temp/vmfile\_md5sum.txt; clean\_temp/vmfile\_md5sum\_info\_obj.o; clean\_temp/x\_Generate\_VMware\_compile.txt; CP064957.compsig; CP064957.md5; CP064957.zip

### **Important Note!**

**IMPORTANT:** Firmware updates must be performed during a system maintenance window, with all I/O to the system halted. In single domain configuration, if user hosts an OS in D3000B (or any storage box) and flash the SEPs, it will hang/crash everytime as SmartComponent will reset the SEPs after flash/code load.

**WARNING!** Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

**NOTE:** All firmware flash progress messages are logged to /var/cpq/D3000B.log and flash summary is logged to /var/cpq/Component.log.

### **Prerequisites**

IMPORTANT: Firmware updates must be performed during a system maintenance window, with all I/O to the system halted.

WARNING! Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

NOTE: All firmware flash progress messages are logged to /var/cpq/D3000B.log and flash summary is logged to /var/cpq/Component.log.

### **Fixes**

**The following fixes were incorporated in this version:**

- Code optimization to save memory repo.
- TLB exception seen while doing esp reset when expander reset was in progress.
- Added the psoc 8.93 binary in peripheral images, updated the reveille version numbers.
- Added whole new Delta PS-pmbus code , Updated the ESP version number.

Please refer to the [Release Notes](#) for the complete listing of fixes, enhancements, known issues and work-arounds corresponding to this firmware.

### **Enhancements**

Added support of ESXi 9.0

Removed support of ESXi 7.0

### **Supported Devices and Features**

The D3610B / D3710B Enclosure can be attached to any of the following HPE Storage Controllers and Host Bus Adapters :

- Smart Array P408e-p Controller
- Smart Array E208e-p Controller

---

HPE D6020 12Gb SAS Disk Enclosure ROM Flash Component for VMware (ESXi)

Version: 2.74 (R) **(Recommended)**

Filename: clean\_temp/\_obj\_data\_output\_64bit.txt; clean\_temp/Config.xml; clean\_temp/CP064960.tgz; clean\_temp/CP064960.vmcfg; clean\_temp/CP064960.vmxex64; clean\_temp/CP064960.vmfile; clean\_temp/CP064960.xml; clean\_temp/Generate\_VMexe.o; clean\_temp/i\_SKIP\_LINE.txt; clean\_temp/my\_md5sum\_info\_obj.o; clean\_temp/my\_scexe\_script.sh; clean\_temp/my\_scexe\_script\_obj.o; clean\_temp/obj\_data\_output\_bits.txt; clean\_temp/original\_scexe\_md5sum.txt; clean\_temp/tarball\_md5sum.txt; clean\_temp/tarball\_md5sum\_info\_obj.o; clean\_temp/the\_final\_zip/Config.xml; clean\_temp/the\_final\_zip/CP064960.vmcfg; clean\_temp/the\_final\_zip/CP064960.vmxex64; clean\_temp/the\_final\_zip/CP064960.vmfile; clean\_temp/the\_final\_zip/CP064960.xml;

clean\_temp/the\_final\_zip/README.txt; clean\_temp/vmfile\_md5sum.txt; clean\_temp/vmfile\_md5sum\_info\_obj.o;  
clean\_temp/x\_Generate\_VMware\_compile.txt; CP064960.compsig; CP064960.md5; CP064960.zip

### **Important Note!**

**IMPORTANT:** Firmware updates must be performed during a system maintenance window, with all I/O to the system halted. In single domain configuration, if user hosts an OS in D6020(or any storage box) and flash the SEPs, it will hang/crash everytime as SmartComponent will reset the SEPs after flash/codeload.

**WARNING!** Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

**NOTE:** All firmware flash progress messages are logged to /var/cpq/D6020.log and flash summary is logged to /var/cpq/Component.log.

### **Prerequisites**

IMPORTANT: Firmware updates must be performed during a system maintenance window, with all I/O to the system halted.

WARNING! Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

NOTE: All firmware flash progress messages are logged to /var/cpq/D6020.log and flash summary is logged to /var/cpq/Component.log.

### **Fixes**

**The following fixes were incorporated in this version:**

- Temperature sensors logic inside gSEP model and SES database
- When an IOM is pulled the surviving IOM reports false critical temperatures

Please refer to the [Release Notes](#) for the complete listing of fixes, enhancements, known issues and work-arounds corresponding to this firmware.

### **Enhancements**

Added support of ESXi 9.0

Removed support of ESXi 7.0

### **Supported Devices and Features**

The D6020 Enclosure can be attached to any of the following HPE Storage Controllers and Host Bus Adapters :

- Smart Array P408e-p Controller
- Smart Array E208e-p Controller

---

HPE D8000 12Gb SAS Disk Enclosure ROM Flash Component for VMware (ESXi)

Version: 0130 (F) **(Recommended)**

Filename: clean\_temp/\_obj\_data\_output\_64bit.txt; clean\_temp/Config.xml; clean\_temp/CP064963.tgz; clean\_temp/CP064963.vmcfg;  
clean\_temp/CP064963.vmxexe64; clean\_temp/CP064963.vmfile; clean\_temp/CP064963.xml; clean\_temp/Generate\_VMexe.o;  
clean\_temp/i\_SKIP\_LINE.txt; clean\_temp/my\_md5sum\_info\_obj.o; clean\_temp/my\_scexe\_script.sh; clean\_temp/my\_scexe\_script\_obj.o;  
clean\_temp/obj\_data\_output\_bits.txt; clean\_temp/original\_scexe\_md5sum.txt; clean\_temp/tarball\_md5sum.txt;  
clean\_temp/tarball\_md5sum\_info\_obj.o; clean\_temp/the\_final\_zip/Config.xml; clean\_temp/the\_final\_zip/CP064963.vmcfg;  
clean\_temp/the\_final\_zip/CP064963.vmxexe64; clean\_temp/the\_final\_zip/CP064963.vmfile; clean\_temp/the\_final\_zip/CP064963.xml;  
clean\_temp/the\_final\_zip/README.txt; clean\_temp/vmfile\_md5sum.txt; clean\_temp/vmfile\_md5sum\_info\_obj.o;  
clean\_temp/x\_Generate\_VMware\_compile.txt; CP064963.compsig; CP064963.md5; CP064963.zip

### **Important Note!**

**IMPORTANT:** Firmware updates must be performed during a system maintenance window, with all I/O to the system halted. In single domain configuration, if user hosts an OS in D8000(or any storage box) and flash the SEPs, it will hang/crash everytime as SmartComponent will reset the SEPs after flash/codeload.

**WARNING!** Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

**NOTE:** All firmware flash progress messages are logged to /var/cpq/D8000.log and flash summary is logged to /var/cpq/Component.log.

### **Prerequisites**



IMPORTANT: Firmware updates must be performed during a system maintenance window, with all I/O to the system halted.

WARNING! Do not power cycle or restart during the firmware update as this can result in loss of capabilities for this unit. It typically takes several minutes for the firmware to load.

NOTE: All firmware flash progress messages are logged to /var/cpq/D8000.log and flash summary is logged to /var/cpq/Component.log.

## **Fixes**

**The following fixes were incorporated in this version:**

- Smart Array reporting "Storage Enclosure FW upgrade Problem Detected".
- PSU version is showing as "No Ver" after inserted the New bel power PSU.
- GEM\_5\_2 Coverity defect fix.

Please refer to the [Release Notes](#) for the complete listing of fixes, enhancements, known issues and work-arounds corresponding to this firmware.

## **Enhancements**

Added support of ESXi 9.0

Removed support of ESXi 7.0

## **Supported Devices and Features**

The D8000 Enclosure can be attached to any of the following HPE Storage Controllers and Host Bus Adapters :

- HPE Smart Array P408e-p Controller
- HPE Smart Array E208e-p Controller

---

Online Firmware Flash for ESXi - HPE Gen10 Plus Boot Controller NS204i-p, NS204i-d, NS204i-t, NS204i-r, NS204i-u and NS204i-d Gen11  
Version: 1.0.14.1063 (C) **(Recommended)**  
Filename: CP064740.compsig; CP064740.zip

### **Important Note!**

- **This version is the minimum required version for Gen10 Plus device to upgrade to latest FW**
- **You can get Firmware Package version 1.2.14.1004 or latest FW version from <https://www.hpe.com/global/swpublishing/MTX-318c8e8298704d8bb4f991eb4d> and update it via iLO without any OS dependency.**

## **Enhancements**

- Added ESXi9.0 support.

---

Online ROM Flash Component for VMware ESXi - HPE 12Gb/s SAS Expander Firmware for HPE Smart Array Controllers and HPE HBA Controllers  
Version: 5.15 (C) **(Recommended)**  
Filename: CP064922.compsig; CP064922.zip

### **Important Note!**

- **Do NOT downgrade FW to previous version if your current expander is 5.10; please upgrade to 5.15 immediately.**

## **Enhancements**

- Added ESXi9.0 support.

---

Online ROM Flash Component for VMware ESXi - HPE Apollo 2000 Gen10 Plus Backplane Expander FW  
Version: 1.27 (C) **(Recommended)**  
Filename: CP064920.compsig; CP064920.zip

## **Enhancements**

- Added ESXi9.0 support.

---

Online ROM Flash Component for VMware ESXi - HPE Apollo 4200 Gen10 Plus Backplane Expander Firmware  
Version: 0.39 (D) **(Recommended)**  
Filename: CP064921.compsig; CP064921.zip

### **Prerequisites**

- Before upgrading to 0.39(D), please flash to the transition version 0.39 first by standalone update approach to activate the new PID naming.
- 0.39(B) is the minimum version for Gen10plus 4200 expander FW.
- **0.39 transition version link:** <https://www.hpe.com/global/swpublishing/MTX-baec686eb389427aa933bbf9f0>

### **Enhancements**

- Support ESXi9.0 OS.

---

Online ROM Flash Component for VMware ESXi - HPE Smart Array P408i-p, P408e-p, P408i-a, E208i-p, E208e-p, E208i-a, P816i-a SR Gen10 Controllers  
Version: 7.43 **(Recommended)**  
Filename: CP062902.compsig; CP062902.zip

### **Fixes**

- Fixed an issue where a lockup occasionally occurs when RAID 0 Predictive Spare Rebuilding (PSR) starts.
- Fixed an issue where the fault LED remains lit during the rebuild process of a replaced SSD drive.
- Fixed an issue where the host was unable to retrieve new configuration updates after creating a logical drive on PF drives.
- Fixed an issue where the logical volume status was incorrectly reported as OK on a secured volume if a data drive was replaced with an Otherwise Owned SED drive before reboot.
- Fixed an issue where the surface scan period was not reset to default after factory reset.
- Fixed an issue where the predictive failure drive did not fail even after the Predictive Spare Rebuild (PSR) was completed.
- Fixed an issue where the Controller might have a potential lockup after a JBOD power cycle.
- Fixed an issue where the offline replacement of a failed drive during a spare rebuild led to the failure of the replacement drive.
- Fixed a lockup issue that could occur both during a transformation with an abrupt shutdown, and on subsequent bootup.
- Fixed an intermittent MCTP communication issue during AC power cycle tests on specific configurations.
- Fixed an MCTP communication issue in AMD Turin 2P configurations.
- Fixed a lockup issue that could occur when a timeout occurs with expander attached SATA drives.
- Fixed an issue with improper support checking for the secure erase command.
- Fixed issues for missing active dedicated hot spare member in HII logical drive information and failed drive part of a logical drive in the HII disk utilities.
- Fixed an issue which threw wrong error code, 'InternalError' when creating an array on controller that is waiting on adapter password.
- Fixed an issue When server is powered on with no drives connected to Enclosure. Observe incorrect controller information in iLO Storage tab & Redfish
- Fixed an issue that enclosures Link is missing under Storage URI in Redfish.
- Fixed an issue in which drive resource does not match with Chassis for empty bay.
- Fixed an issue in which incorrect severity warning of drive when sanitize erase operation is in progress.
- Fixed an issue where HealthRollup shows warning during normal state.
- Fixed an issue where CacheSummary.Status.Health shows incorrect during WriteCache degraded.
- Fixed an issue in which PLDM/RDE Read sometimes take longer than 6s during array deletion.

### **Enhancements**

- PLDM Base (Type 0) commands comply with v1.2.0 of the PLDM base specification (DSP0240).
- PLDM Platform Monitoring and Control (Type 2) commands comply with v1.3.0 of the PLDM Platform Monitoring and Control Specification (DSP0248).
- Long-running task support for volume creation/deletion using Redfish and storage resource RDE action operations.

---

Online ROM Flash Component for VMware ESXi - HPE Smart Array P816i-a,P416ie-m,P408i-p, P408e-p, P408i-a,P408i-c,P204i-c,E208i-p, E208e-p, E208i-a, P208i-c SR Gen10  
Version: 5.61 (E) **(Recommended)**  
Filename: CP064739.compsig; CP064739.zip

### **Enhancements**

- Added ESXi9.0 support.
-

## Firmware - Storage Fibre Channel

[Top](#)

HPE Firmware Flash for Emulex Fibre Channel Host Bus Adapters for VMware vSphere 9.0

Version: 2025.03.01 (**Recommended**)

Filename: CP064176.compsig; CP064176.zip

### Important Note!

#### Release notes:

[Broadcom Release notes](#)

This Firmware package contains following firmware versions:

Adapter	Speed	Universal Boot Image	Firmware	UEFI	Boot Bios
HPE SN1200E 16Gb Dual Port Fibre Channel Host Bus Adapter	16Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1200E 16Gb Single Port Fibre Channel Host Bus Adapter	16Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1600E 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1600E 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1610E 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1610E 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1700E 64Gb Single Port Fibre Channel Host Bus Adapter	64Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1700E 64Gb Dual Port Fibre Channel Host Bus Adapter	64Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0

### Prerequisites

Please consult SPOCK for a list of supported configurations available at the following link:

<http://www.hpe.com/storage/spock/>

### Enhancements

This Firmware package contains following firmware versions:

Adapter	Speed	Universal Boot Image	Firmware	UEFI	Boot Bios
HPE SN1200E 16Gb Dual Port Fibre Channel Host Bus Adapter	16Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1200E 16Gb Single Port Fibre Channel Host Bus Adapter	16Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1600E 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1600E 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1610E 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1610E 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1700E 64Gb Single Port Fibre Channel Host Bus Adapter	64Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0
HPE SN1700E 64Gb Dual Port Fibre Channel Host Bus Adapter	64Gb	14.4.473.14	14.4.473.14	14.4.473.8	14.4.469.0

### Supported Devices and Features

This component is supported on following Emulex Fibre Channel Host Bus adapters:

#### 16Gb FC Adapter:

- HPE SN1200E 16Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1200E 16Gb Single Port Fibre Channel Host Bus Adapter

#### 32Gb FC Adapter:

- HPE SN1600E 32Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1600E 32Gb Single Port Fibre Channel Host Bus Adapter
- HPE SN1610E 32Gb Dual port Fibre Channel Host Bus Adapter
- HPE SN1610E 32Gb Single port Fibre Channel Host Bus Adapter

## 64Gb FC Adapter:

- HPE SN1700E 64Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1700E 64Gb Single Port Fibre Channel Host Bus Adapter

HPE Firmware Flash for QLogic Fibre Channel Host Bus Adapters for VMware vSphere 9.0

Version: 2025.03.01 (**Recommended**)

Filename: CP064570.compsig; CP064570.zip

## Important Note!

Release Notes:

[HPE QLogic Adapters Release Notes](#)

This Firmware package contains following firmware versions:

Adapter	Speed	MBI	Firmware	UEFI	Boot Bios
HPE SN1100Q 16GB Dual Port PCIe Fibre Channel Host Bus Adapter	16Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1100Q 16GB Single Port PCIe Fibre Channel Host Bus Adapter	16Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1600Q 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1600Q 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1610Q 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	02.10.08	09.15.05	7.39	0.0
HPE SN1610Q 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	02.10.08	09.15.05	7.39	0.0
HPE SN1700Q 64Gb Dual Port Fibre Channel Host Bus Adapter	64Gb	02.10.08	09.15.05	7.39	0.0
HPE SN1700Q 64Gb Single Port Fibre Channel Host Bus Adapter	64Gb	02.10.08	09.15.05	7.39	0.0

## Prerequisites

Please consult SPOCK for a list of supported configurations available at the following link:

<http://www.hpe.com/storage/spock/>

## Enhancements

This Firmware package contains following firmware versions:

Adapter	Speed	MBI	Firmware	UEFI	Boot Bios
HPE SN1100Q 16GB Dual Port PCIe Fibre Channel Host Bus Adapter	16Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1100Q 16GB Single Port PCIe Fibre Channel Host Bus Adapter	16Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1600Q 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1600Q 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	02.04.09	9.15.05	7.28	3.68
HPE SN1610Q 32Gb Dual Port Fibre Channel Host Bus Adapter	32Gb	02.10.08	09.15.05	7.39	0.0
HPE SN1610Q 32Gb Single Port Fibre Channel Host Bus Adapter	32Gb	02.10.08	09.15.05	7.39	0.0
HPE SN1700Q 64Gb Dual Port Fibre Channel Host Bus Adapter	64Gb	02.10.08	09.15.05	7.39	0.0
HPE SN1700Q 64Gb Single Port Fibre Channel Host Bus Adapter	64Gb	02.10.08	09.15.05	7.39	0.0

## Supported Devices and Features

This component is supported on following Qlogic Fibre Channel Host Bus adapters:

### 16Gb Fibre Channel Host Bus Adapter:

- HPE SN1100Q 16GB Dual Port PCIe Fibre Channel Host Bus Adapter
- HPE SN1100Q 16GB Single Port PCIe Fibre Channel Host Bus Adapter

### 32Gb Fibre Channel Host Bus Adapter:

- HPE SN1600Q 32Gb Single Port Fibre Channel Host Bus Adapter
- HPE SN1600Q 32Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1610Q 32Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1610Q 32Gb Single Port Fibre Channel Host Bus Adapter

## 64Gb Fibre Channel Host Bus Adapter:

- HPE SN1700Q 64Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1700Q 64Gb Single Port Fibre Channel Host Bus Adapter

---

### Software - Management

[Top](#)

HPE iLO Driver Bundle Smart Component for ESXi 8.0 and ESXi 9.0

Version: 2025.03.00 (**Recommended**)

Filename: cp064439.compsig; cp064439.zip

### Enhancements

Support VMware ESXi 9.0.

---

Smart Storage Administrator (SSA) CLI Smart Component for ESXi 9.0 for Gen10/Gen10 Plus/Gen11 Controllers

Version: 2025.03.01 (**Recommended**)

Filename: cp064903.compsig; cp064903.zip

### Important Note!

- Actual ESXi Version is 6.50.8.0

### Enhancements

- Initial Release.

---

### Software - Storage Controller

[Top](#)

HPE MegaRAID Storage Administrator StorCLI for VMware9.0 (For Gen10P and Gen11 Controllers)

Version: 2025.01.01 (**Recommended**)

Filename: cp064599.compsig; cp064599.zip

### Important Note!

- Actual ESXi Version is 007.3011.0000.0000

### Enhancements

- Initial release.

---

### Software - Storage Fibre Channel

[Top](#)

HPE QLogic Fibre Channel driver component for VMware vSphere 9.0

Version: 2025.03.01 (**Recommended**)

Filename: cp064287.compsig; cp064287.zip

### Important Note!

Release Notes:

[HPE QLogic Adapters Release Notes](#)

This component is intended to be used by HPE applications. It is a zip that contains the same driver deliverable available from the vmware.com and the HPE vibspot.hpe.com webpages, plus an HPE specific CPXXXX.xml file.

This driver is only supported on VMware ESXi 9.0

### Prerequisites

Please consult SPOCK for a list of supported configurations available at the following link:

<http://www.hpe.com/storage/spock/>

### Enhancements

Driver version 5.4.83.1

This driver is only supported on VMware ESXi 9.0

## **Supported Devices and Features**

This component is supported on following Qlogic Fibre Channel Host Bus adapters:

### **16Gb Fibre Channel Host Bus Adapter:**

- HPE SN1100Q 16GB Dual Port PCIe Fibre Channel Host Bus Adapter
- HPE SN1100Q 16GB Single Port PCIe Fibre Channel Host Bus Adapter

### **32Gb Fibre Channel Host Bus Adapter:**

- HPE SN1600Q 32Gb Single Port Fibre Channel Host Bus Adapter
- HPE SN1600Q 32Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1610Q 32Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1610Q 32Gb Single Port Fibre Channel Host Bus Adapter

### **64Gb Fibre Channel Host Bus Adapter:**

- HPE SN1700Q 64Gb Dual Port Fibre Channel Host Bus Adapter
- HPE SN1700Q 64Gb Single Port Fibre Channel Host Bus Adapter

---

## **Software - System Management**

[Top](#)

HPE Agentless Management Bundle for ESXi for HPE Gen10 and Gen10 Plus Servers

Version: 802.11.11.0 **(Recommended)**

Filename: amsdComponent\_802.11.11.0.4-1\_24616773.zip

### **Fixes**

See the [AMS Release Notes](#) for information about the issues resolved in this release.

### **Enhancements**

See the [AMS Release Notes](#) for information about the enhancements in this release.

---

HPE Agentless Management Bundle Smart Component on ESXi for Gen10 and Gen10 Plus Servers

Version: 2025.03.01 **(Recommended)**

Filename: cp062292.compsig; cp062292.zip

### **Fixes**

See the [AMS Release Notes](#) for information about the issues resolved in this release.

### **Enhancements**

See the [AMS Release Notes](#) for information about the enhancements in this release.

---

ROM Flash Firmware Package - HPE Apollo 4200 Gen10/HPE ProLiant XL420 Gen10 (U39) Servers

Version: 3.42\_02-21-2025 (**Recommended**)

Filename: U39\_3.42\_02\_21\_2025.fwpkg

**Important Note!****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE Apollo 4200 Gen10/ProLiant XL420 Gen10 System ROM - U39

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE Apollo 4510 Gen10/HPE ProLiant XL450 Gen10 (U40) Servers

Version: 3.42\_02-21-2025 **(Recommended)**

Filename: U40\_3.42\_02\_21\_2025.fwpkg

**Important Note!****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE Apollo 4510 Gen10/HPE ProLiant XL450 Gen10 System ROM - U40

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**



Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant DL160 Gen10/DL180 Gen10 (U31) Servers

Version: 3.42\_02-21-2025 (**Recommended**)

Filename: U31\_3.42\_02\_21\_2025.fwpkg

**Important Note!**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant DL160 Gen10/DL180 Gen10 System ROM - U31

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

## **Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant DL20 Gen10 (U43) Servers  
Version: 3.52\_02-21-2025 **(Recommended)**  
Filename: U43\_3.52\_02\_21\_2025.fwpkg

## **Important Note!**

### **Important Notes:**

This version of the System ROM contains updates aligned with the Intel Product Update (IPU) version IPU.2025.1 guidance. This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 05.01.05.005.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

### **Deliverable Name:**

HPE ProLiant DL20 Gen10 System ROM - U43

### **Release Version:**

3.52\_02-21-2025

### **Last Recommended or Critical Revision:**

3.52\_02-21-2025

### **Previous Revision:**

3.50\_01-16-2025

### **Firmware Dependencies:**

None

### **Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

### **Problems Fixed:**

Addressed an issue where the system iLO remote console might hang when the System Utilities Language is set to Japanese.

### **Known Issues:**

None

## **Fixes**

### **Important Notes:**

This version of the System ROM contains updates aligned with the Intel Product Update (IPU) version IPU.2025.1 guidance.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

### **Firmware Dependencies:**

None

### **Problems Fixed:**

Addressed an issue where the system iLO remote console might hang when the System Utilities Language is set to Japanese.

### **Known Issues:**

None

## **Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant DL20 Gen10 Plus Servers  
Version: 2.34\_03-11-2025 **(Recommended)**  
Filename: U60\_2.34\_03\_11\_2025.fwpkg

### **Important Note!**

#### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 06.00.03.700 (2.30\_01\_07\_2025).

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

#### **Deliverable Name:**

HPE ProLiant DL20 Gen10 Plus System ROM - U60

#### **Release Version:**

2.34\_03-11-2025

#### **Last Recommended or Critical Revision:**

2.34\_03-11-2025

#### **Previous Revision:**

2.32\_02-21-2025

#### **Firmware Dependencies:**

None

#### **Enhancements/New Features:**

None

#### **Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

#### **Known Issues:**

None

### **Fixes**

#### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 06.00.03.700 (2.30\_01\_07\_2025).

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

#### **Firmware Dependencies:**

None

#### **Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

#### **Known Issues:**

None

---

ROM Flash Firmware Package - HPE ProLiant DL325 Gen10 (A41) Servers  
Version: 3.42\_02-21-2025 **(Recommended)**  
Filename: A41\_3.42\_02\_21\_2025.fwpkg

### **Important Note!**

#### **Important Notes:**

This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

This revision of the System ROM includes AMD reference code NaplesPI 1.0.0.P for AMD 1st Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant DL325 Gen10 System ROM - A41

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

None

**Known Issues:**

None

**Enhancements**

**Important Notes:**

This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

This revision of the System ROM includes AMD reference code NaplesPI 1.0.0.P for AMD 1st Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Known Issues:**

None

---

ROM Flash Firmware Package - HPE ProLiant DL360 Gen10 (U32) Servers

Version: 3.42\_02-21-2025 **(Recommended)**

Filename: U32\_3.42\_02\_21\_2025.fwpkg

**Important Note!**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant DL360 Gen10 System ROM - U32

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant DL380 Gen10 (U30) Servers

Version: 3.42\_02-21-2025 **(Recommended)**

Filename: U30\_3.42\_02\_21\_2025.fwpkg

**Important Note!****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE DL380 Gen10 System ROM - U30

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant DL385 Gen10 (A40) Servers

Version: 3.42\_02-21-2025 (**Recommended**)

Filename: A40\_3.42\_02\_21\_2025.fwpkg

**Important Note!**

**Important Notes:**

This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

This revision of the System ROM includes AMD reference code NaplesPI 1.0.0.P for AMD 1st Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant DL385 Gen10 System ROM - A40

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

None

**Known Issues:**

None

**Enhancements****Important Notes:**

This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

This revision of the System ROM includes AMD reference code NaplesPI 1.0.0.P for AMD 1st Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Known Issues:**

None

---

ROM Flash Firmware Package - HPE ProLiant DL560 Gen10/DL580 Gen10 (U34) Servers

Version: 3.42\_02-21-2025 **(Recommended)**

Filename: U34\_3.42\_02\_21\_2025.fwpkg

**Important Note!****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant DL560 Gen10/DL580 Gen10 System ROM - U34

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

## **Fixes**

### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

### **Firmware Dependencies:**

None

### **Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

### **Known Issues:**

None

## **Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant MicroServer Gen10 Plus v2 (U64) Servers

Version: 2.34\_03-11-2025 **(Recommended)**

Filename: U64\_2.34\_03\_11\_2025.fwpkg

## **Important Note!**

### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 06.00.03.700 (2.30\_01\_07\_2025).

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

### **Deliverable Name:**

HPE ProLiant MicroServer Gen10 Plus v2 System ROM - U64

### **Release Version:**

2.34\_03-11-2025

### **Last Recommended or Critical Revision:**

2.34\_03-11-2025

### **Previous Revision:**

2.32\_02-21-2025

### **Firmware Dependencies:**

None

### **Enhancements/New Features:**

None

### **Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

### **Known Issues:**

None

## **Fixes**

### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 06.00.03.700 (2.30\_01\_07\_2025).



Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

**Known Issues:**

None

---

ROM Flash Firmware Package - HPE ProLiant ML110 Gen10 (U33) Servers

Version: 3.42\_02-21-2025 **(Recommended)**

Filename: U33\_3.42\_02\_21\_2025.fwpkg

**Important Note!**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant ML110 Gen10 System ROM - U33

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant ML30 Gen10 (U44) Servers

Version: 3.52\_02-21-2025 **(Recommended)**

Filename: U44\_3.52\_02\_21\_2025.fwpkg

**Important Note!****Important Notes:**

This version of the System ROM contains updates aligned with the Intel Product Update (IPU) version IPU.2025.1 guidance. This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 05.01.05.005.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant ML30 Gen10 System ROM - U44

**Release Version:**

3.52\_02-21-2025

**Last Recommended or Critical Revision:**

3.52\_02-21-2025

**Previous Revision:**

3.50\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes****Important Notes:**

This version of the System ROM contains updates aligned with the Intel Product Update (IPU) version IPU.2025.1 guidance. This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 05.01.05.005.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Firmware Package - HPE ProLiant ML30 Gen10 Plus Servers  
Version: 2.34\_03-11-2025 **(Recommended)**  
Filename: U61\_2.34\_03\_11\_2025.fwpkg

### **Important Note!**

#### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 06.00.03.700 (2.30\_01\_07\_2025).

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

#### **Deliverable Name:**

HPE System ROM - U61

#### **Release Version:**

2.34\_03-11-2025

#### **Last Recommended or Critical Revision:**

2.34\_03-11-2025

#### **Previous Revision:**

2.32\_02-21-2025

#### **Firmware Dependencies:**

None

#### **Enhancements/New Features:**

None

#### **Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

#### **Known Issues:**

None

### **Fixes**

#### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 06.00.03.700 (2.30\_01\_07\_2025).

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

#### **Firmware Dependencies:**

None

#### **Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

#### **Known Issues:**

None

---

ROM Flash Firmware Package - HPE ProLiant ML350 Gen10 (U41) Servers  
Version: 3.42\_02-21-2025 **(Recommended)**  
Filename: U41\_3.42\_02\_21\_2025.fwpkg

### **Important Note!**

#### **Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant ML350 Gen10 System ROM - U41

**Release Version:**

3.42\_02-21-2025

**Last Recommended or Critical Revision:**

3.42\_02-21-2025

**Previous Revision:**

3.40\_01-16-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Fixes**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.01.05.105.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system iLO remote console might hang in glyph loop error handling when the System Utilities Language is set to Japanese.

**Known Issues:**

None

**Enhancements**

Added pop-up message for all Intelligent Provisioning boot paths to warn users of the risk of data loss.

---

ROM Flash Universal Firmware Package - HPE ProLiant DL325/DL325 v2/DL345 Gen10 Plus (A43) Servers

Version: 3.64\_03-11-2025 **(Recommended)**

Filename: A43\_3.64\_03\_11\_2025.fwpkg

**Important Note!**

**Important Notes:**

This revision of the System ROM includes AMD reference code MilanPI 1.0.0.F for AMD 3rd Generation EPYC processors. This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE ProLiant DL325/DL325 v2/DL345 Gen10 Plus System ROM - A43

**Release Version:**

3.64\_03-11-2025

**Last Recommended or Critical Revision:**

3.64\_03-11-2025

**Previous Revision:**

3.62\_02-21-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

None

**Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

**Known Issues:**

None

**Fixes**

**Important Notes:**

This revision of the System ROM includes AMD reference code MilanPI 1.0.0.F for AMD 3rd Generation EPYC processors. This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

**Known Issues:**

None

---

ROM Flash Universal Firmware Package - HPE ProLiant DL360/DL380 Gen10 Plus (U46) Servers

Version: 2.34\_03-11-2025 **(Recommended)**

Filename: U46\_2.34\_03\_11\_2025.fwpkg

**Important Note!**

**Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.04.04.702 (2.30\_01\_06\_2025).

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE DL360 Gen10 Plus/DL380 Gen10 Plus System ROM - U46

**Release Version:**

2.34\_03-11-2025

**Last Recommended or Critical Revision:**

2.32\_02-21-2025

**Previous Revision:**

2.32\_02-21-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

None

**Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

**Known Issues:**

None

**Fixes****Important Notes:**

This version of the System ROM should be paired with Server Platform Services (SPS) Firmware 04.04.04.702 (2.30\_01\_06\_2025).

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

**Known Issues:**

None

---

ROM Flash Universal Firmware Package - HPE ProLiant DL365/DL385/DL385 v2 Gen10 Plus (A42) Servers

Version: 3.64\_03-11-2025 **(Recommended)**

Filename: A42\_3.64\_03\_11\_2025.fwpkg

**Important Note!****Important Notes:**

This revision of the System ROM includes AMD reference code MilanPI 1.0.0.F for AMD 3rd Generation EPYC processors. This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Deliverable Name:**

HPE DL365 Gen10 Plus/DL385 Gen10 Plus/DL385 v2 Gen10 Plus System ROM - A42

**Release Version:**

3.64\_03-11-2025

**Last Recommended or Critical Revision:**

3.64\_03-11-2025

**Previous Revision:**

3.62\_02-21-2025

**Firmware Dependencies:**

None

**Enhancements/New Features:**

None

**Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

**Known Issues:**

None

**Fixes****Important Notes:**

This revision of the System ROM includes AMD reference code MilanPI 1.0.0.F for AMD 3rd Generation EPYC processors. This revision of the System ROM includes AMD reference code RomePI 1.0.0.L for AMD 2nd Generation EPYC processors.

Details about reported security vulnerabilities and their mitigation can be found at the following link [Security Bulletin Library | HPE Support](#).

**Firmware Dependencies:**

None

**Problems Fixed:**

Addressed an issue where the system might RSOD when performing firmware update via Firmware Management Protocol.

**Known Issues:**

None

---

Get connected

[hpe.com/info/getconnected](https://hpe.com/info/getconnected)

Current HPE driver, support, and security alerts delivered directly to your desktop

© Copyright 2023 Hewlett Packard Enterprise Development Company, L.P.

The information contained herein is subject to change without notice. The only warranties for HPE products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HPE shall not be liable for technical or editorial errors or omissions contained herein.

Trademark acknowledgments, if needed.

Update April 16 2025

